

# ***FLASHCUT CNC***

CONTROL MADE SIMPLE

## **25 Amp Servo Pro Series CNC Controller Hardware Guide**



### **Midwest Office**

444 Lake Cook Road, Suite 22

Deerfield, IL 60015

Phone (847) 940-9305 ♦ Fax (847) 940-9315

[www.flashcutcnc.com](http://www.flashcutcnc.com)

©1998-2019 WPI, Inc.

<b>Getting Started.....</b>	<b>1</b>
About This Manual.....	1
Turning Off the Controller.....	1
Safety and Usage Guidelines.....	2
<b>Servo CNC Controller.....</b>	<b>3</b>
Front Panel.....	3
<i>Fan</i> .....	3
<i>Power Switch</i> .....	3
<i>LEDs</i> .....	4
Rear Panel.....	5
<i>Power Inlet</i> .....	5
<i>Relay</i> .....	5
<i>Voltage Selector Switch</i> .....	6
<i>Servo Tuning Port</i> .....	6
<i>Motor Power Connectors</i> .....	7
<i>Motor Feedback Connectors</i> .....	8
<i>Motor Signals</i> .....	9
<i>USB</i> .....	10
<i>Outputs</i> .....	10
<i>Inputs</i> .....	11
<i>Accessory Connector</i> .....	12
<b>Connection Diagram.....</b>	<b>13</b>
<b>Servo Motor Cabling.....</b>	<b>14</b>
Power Cable and Wiring.....	14
Feedback Cable and Wiring.....	15
<b>Motor Drive Settings.....</b>	<b>16</b>
Configuring the Drives.....	16
<i>Launching ServoWare</i> .....	17
<i>Connecting to the Drives</i> .....	18
<i>Saving the Configuration</i> .....	18
<i>Switches 1–4 (Address Setting)</i> .....	19
<i>Switch 5 (Unused)</i> .....	20
<i>Switch 6 (Command Source)</i> .....	20
<i>Switches 7&amp;8 (Communication Termination)</i> .....	20
Indicator LEDs.....	20
<i>Motor Power</i> .....	20
<i>Logic Power</i> .....	20
<i>Fault</i> .....	20
<i>Enable</i> .....	20
Auxiliary Accessory Connector.....	21
<i>Encoder Following Cable</i> .....	21
<i>Brake Signal Cable</i> .....	21
FlashCut CNC Software Configuration.....	22
<i>Motor Signal Setup</i> .....	22
<i>Input Line Setup</i> .....	22
<b>Tuning and Commutation.....</b>	<b>24</b>
Current Loop Tuning.....	25

<i>Inputs/Outputs Configuration Setup</i> .....	25
<i>Waveform Generator Setup</i> .....	25
<i>Oscilloscope Setup</i> .....	25
<i>Tuning</i> .....	26
Commutation.....	27
<i>AutoCommutation™</i> .....	27
<i>AutoCommutation™ Warnings</i> .....	28
Velocity Loop Tuning.....	29
<i>Waveform Generator Setup</i> .....	29
<i>Oscilloscope Setup</i> .....	29
<i>Tuning</i> .....	30
Position Loop Tuning.....	32
<i>Waveform Generator Setup</i> .....	32
<i>Oscilloscope Setup</i> .....	32
<i>Tuning</i> .....	33
Velocity Feedback Filter.....	34
<i>Effects of the Feedback Filter</i> .....	34
<i>Filtering Results</i> .....	34
<b>Signal Generator</b> .....	<b>35</b>
LEDs.....	35
<i>Power-On Sequence</i> .....	35
<i>During Operation</i> .....	35
Inputs.....	36
<i>Internal Power</i> .....	36
<i>External Isolated Power</i> .....	36
Outputs.....	38
Motor Signals.....	39
Jumper Settings.....	40
<i>JP83 – DB to USB Ground</i> .....	40
<i>JP84/JP85 – Input Power Select</i> .....	41
<i>JP86 – USB to Chassis Ground</i> .....	41
<i>JP87 – Internal Signal to Chassis Ground</i> .....	41
Internal Connections.....	42
<i>JP30 – Auxiliary Input</i> .....	42
<i>JP31 – Status LEDs</i> .....	43
<i>JP32 – Bus Expansion</i> .....	44
<i>JP33 – Step and Direction</i> .....	45
<i>JP40 – Input Aux</i> .....	46
<i>JP50 – Output Aux</i> .....	47
<i>JP53 – Low-Side Relay</i> .....	47
<i>JP71-75 – Axis Plug-In Interfaces</i> .....	48
<i>JP80 – Rear Panel Power</i> .....	49
<i>JP81 – Rear Panel Fuse</i> .....	49
<i>JP82 – Front Panel Switch</i> .....	49
<b>Servo Power Board</b> .....	<b>50</b>
Internal Connections.....	51
<i>P101 – Transformer Connector</i> .....	51
<i>P102 – AUX Motor Power Connector</i> .....	51

<i>P103 – Fan Connector.....</i>	<i>52</i>
<i>P107 - Motor Power Connector (x3).....</i>	<i>52</i>
<i>P110 &amp; P111 – Motor Power Connectors.....</i>	<i>53</i>
<i>P202 – Signal Generator Power Connector.....</i>	<i>53</i>
<i>P204 – LED Connector.....</i>	<i>54</i>
<i>P301 – Accessory Connector.....</i>	<i>54</i>
<i>P405 – Internal Emergency Stop Connector.....</i>	<i>55</i>
<i>P501 – Relay Control Connector.....</i>	<i>55</i>
<i>P600 – Motor Power Resistor Connector.....</i>	<i>55</i>
<i>P601 – Emergency Stop Output Connector.....</i>	<i>56</i>
<i>P701 – Brake 1 Input Connector.....</i>	<i>56</i>
<i>P702 – Brake 2 Input Connector.....</i>	<i>56</i>
Switch Settings.....	57
<i>SW502 – DIP Switches.....</i>	<i>57</i>
Fuses.....	58
<i>F101 – Motor AC Fuse.....</i>	<i>58</i>
<i>F201 – 18.8VAC Fuse.....</i>	<i>58</i>
LED Indicators.....	58
<b>Controller Maintenance.....</b>	<b>59</b>
External Maintenance.....	59
<i>Fan Filter.....</i>	<i>59</i>
<i>Power Inlet Fuses.....</i>	<i>59</i>
Internal Maintenance.....	61
<i>Removing The Lid.....</i>	<i>61</i>
<i>Replacing Fuses.....</i>	<i>61</i>
<i>Adding/Replacing a Drive.....</i>	<i>62</i>
<b>Pin Location Index.....</b>	<b>64</b>
Signal Locations.....	64
Voltage/GND Locations.....	67
<i>+5VDC.....</i>	<i>67</i>
<i>GND.....</i>	<i>67</i>
<i>OPT-VCC.....</i>	<i>68</i>
<i>OPT-GND.....</i>	<i>68</i>
<i>+12VDC.....</i>	<i>68</i>
<b>Wiring Appendix.....</b>	<b>69</b>
Example Wiring.....	69
<i>Typical Output Line Circuit.....</i>	<i>69</i>
<i>Typical Input Line Circuit – Internal Power.....</i>	<i>70</i>
<i>Typical Input Line Circuit – External Power.....</i>	<i>71</i>
<i>Proximity Sensors.....</i>	<i>72</i>
Internal Schematic.....	73

# Getting Started

## *About This Manual*

FlashCut CNC is a unique application involving hardware and software. We recommend that you read all of these instructions before using the product.



**Since automated machining is potentially dangerous, please take the time to completely read through this manual and the software User's Guide to understand the operation of the electronics, software and machine before cutting a part.**

## *Turning Off the Controller*



**Always turn off the CNC Controller when it is not in use.**

## ***Safety and Usage Guidelines***



**When running an automated machine tool, safety is of the utmost importance. For proper and safe use of the FlashCut CNC program and your CNC machine, the following safety guidelines must be followed:**

- 1. Never let the machine tool run unattended.**
- 2. Require any person in the same room as a running machine tool to wear safety goggles and to stay a safe distance from the machine.**
- 3. Allow only trained operators to run the machine tool. Any operator must have:**
  - Knowledge of machine tool operation.
  - Knowledge of personal computer operation.
  - Knowledge of Microsoft Windows.
  - Good common sense.
- 4. Place safety guards around the machine to prevent injury from flying objects. It is highly recommended that you build a safety shield around the entire tool envelope.**
- 5. Never place any part of your body within the tool envelope while the machine is online, since unexpected machine movement can occur at any time.**
- 6. Always keep the tool envelope tidy and free of any loose objects.**
- 7. Be on alert for computer crashes at all times.**

**FlashCut CNC, Inc. is not responsible for the safe installation and use of this product. You and only you are responsible for the safety of yourself and others during the operation of your CNC machine tool. FlashCut CNC supplies this product but has no control over how it is installed or used. Always be careful!**


**FlashCut CNC, Inc. or its affiliates are not responsible for damage to any equipment or workpiece resulting from use of this product.**

**If you do not understand and agree with all of the above safety guidelines, do not use this product.**

# Servo CNC Controller

## Front Panel

The front panel provides the main power switch, input for the cooling system and diagnostic LEDs.

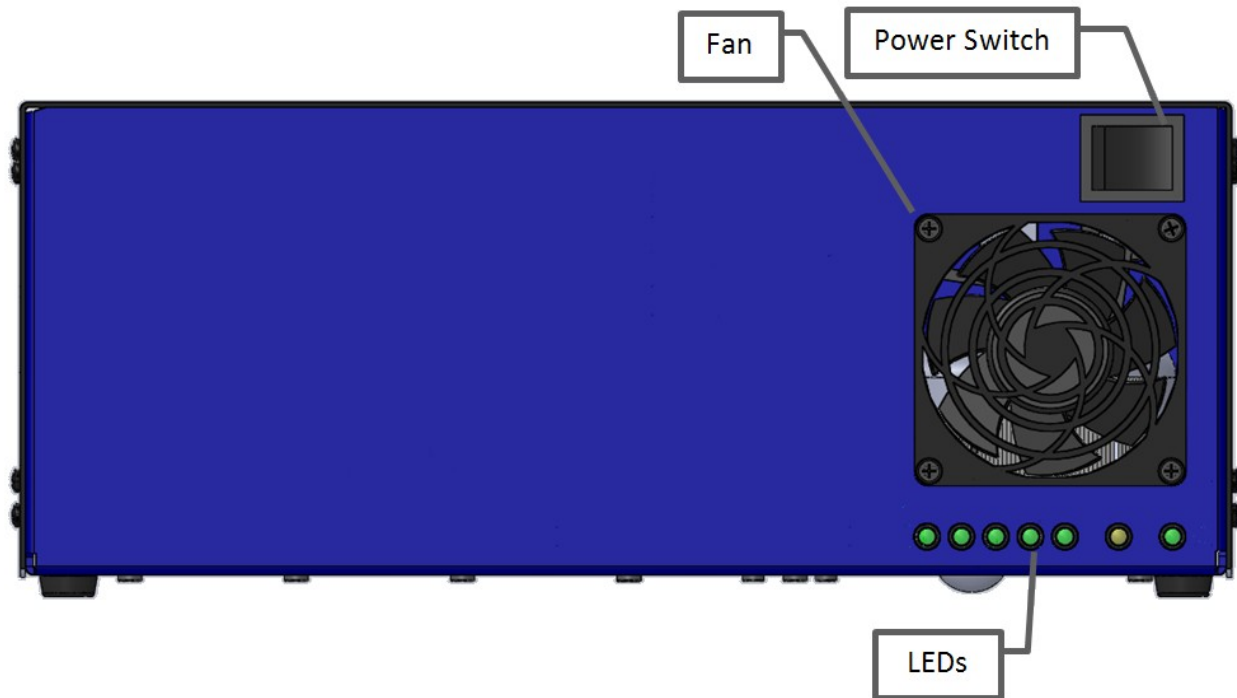

### Fan

The fan is used to cool the internal components of the controller. Do not block air flow by placing the fan in front of objects or objects in front of the fan.


The fan is the input of the cooling system and has a filter used to catch large, harmful debris. The filter should be cleaned or replaced based on the environment it is kept in. The exhaust for the cooling system in the lid on the left side of the controller. Please see the Maintenance section for more information on changing the filter.

### Power Switch

The power switch turns the unit on and off. If there is ever a communications error while running FlashCut CNC, it may be necessary to turn the switch off, wait 10 seconds and turn it back on to reset the internal microprocessor.

## LEDs

The front panel LEDs can be used as a diagnostic tool to know the state of the system.

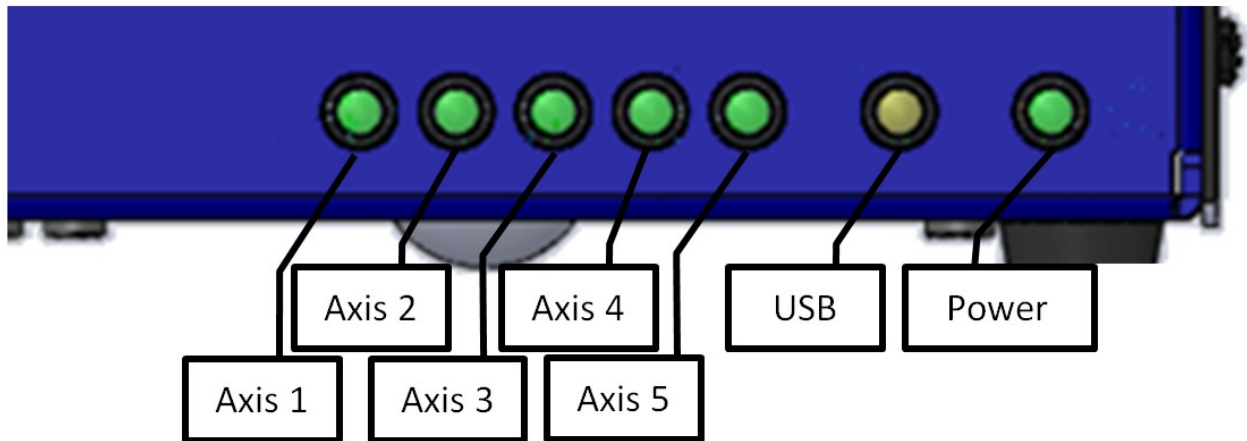

The five LEDs grouped on the left indicate the motion on axes 1-5. The brightness of the LED is based on the step rate of the axis. The faster an axis is moving, the brighter the axis LED will be. The axis LEDs are numbered 1-5 going left to right.


The amber LED indicates that the controller has a physical connection to the USB port on the PC. This is not an indication that the controller is connected through the software.

The LED to the right is the power/diagnostic LED. This LED is used to indicate that the unit is powered on.



## Rear Panel

The rear panel of the CNC controller provides a connection point for main power, motor connections and all control signals used in the CNC system.

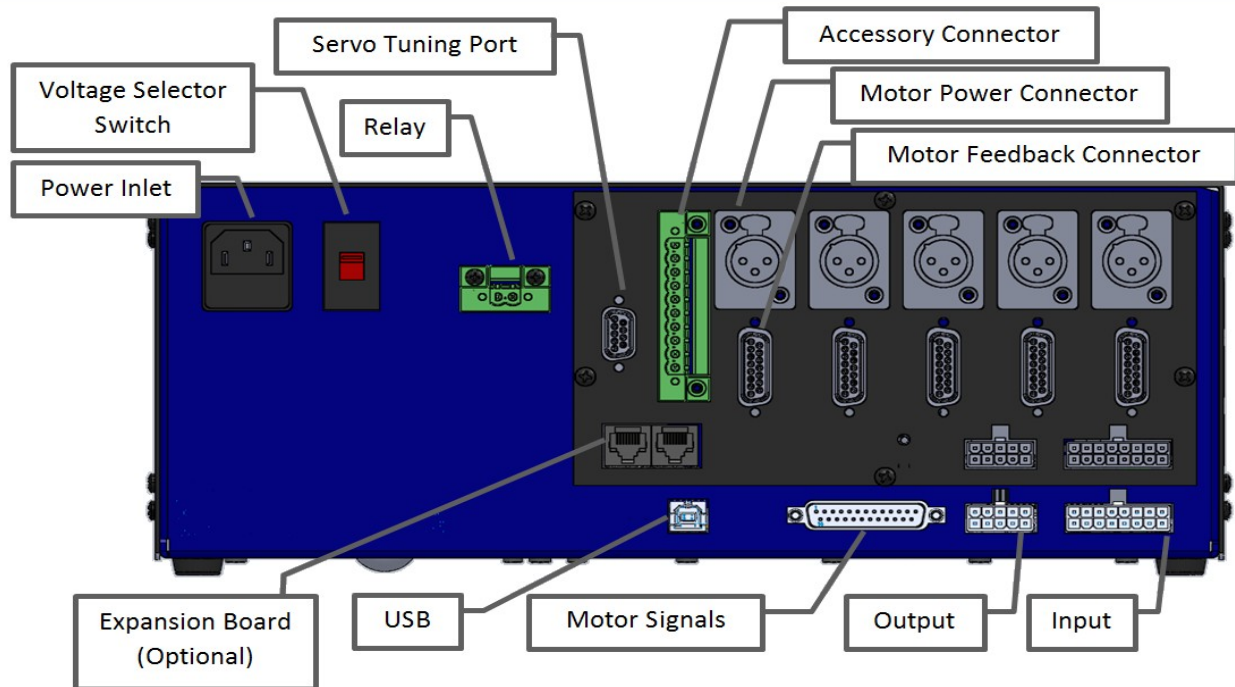

### Power Inlet

The power inlet is a receptacle for supplying mains power to the controller. The unit is shipped with a standard grounded power cable for use with a 115VAC wall outlet.

The controller is designed to use 115 – 230 VAC. Make sure the voltage sector switch is in the proper position for the mains supply.

There are two fuses built into the power inlet receptacle that are rated to 10A for 115VAC installation. If the unit is going to be powered with 230VAC, the fuses need to be replaced with 5A fuses. If the power switch is in the on position and there are no lights on, then you should investigate the fuse for damage. See the Maintenance section for information on replacing the fuses.

### Relay

The relay connector provides a switch closure for controlling both AC and DC devices. This connection is not polarity-sensitive and has a 0.5 Amp maximum current load. If the controller comes equipped with a Mini I/O Expansion Board, this connector is not wired as a relay because the same signal is available on the Mini I/O Expansion Board. This connector may be used for a constant 24VDC source and will be marked as such. This power source can be used for proximity sensors and other low-current devices.

## Voltage Selector Switch

The voltage selector switch allows the controller to use an external power source of 115 or 230 VAC. If the input power is wired for 230VAC, then simply flip the switch with a flat-head screwdriver so that “230V” is clearly visible. If the input power is wired for 115 VAC, then flip the switch until “115V” is clearly visible.



**Severe damage can occur if 115V is selected and your source is wired for 230VAC.**


## Servo Tuning Port

This port allows for the communication of the servo motor drives with a PC. The provided DB-9 serial cable plugs into the port from a USB to serial adapter (also provided). Please see the section on ServoWare for more information on drive communications.

## Motor Power Connectors

The motor power cables plug into these connectors. The numerical motor lines are correlated to any combination of the X, Y, Z, A and/or B axes in the Axes menu in the FlashCut CNC software. Each motor connector is a female XLR3 Receptacle (see the section on Motor Cabling for mating connector information). The pin assignments for the motor power connector are as follows:


XLR4 Connector for Motor Power	
<i>Pin No.</i>	<i>Signal</i>
1	Phase U
2	Phase V
3	Phase W

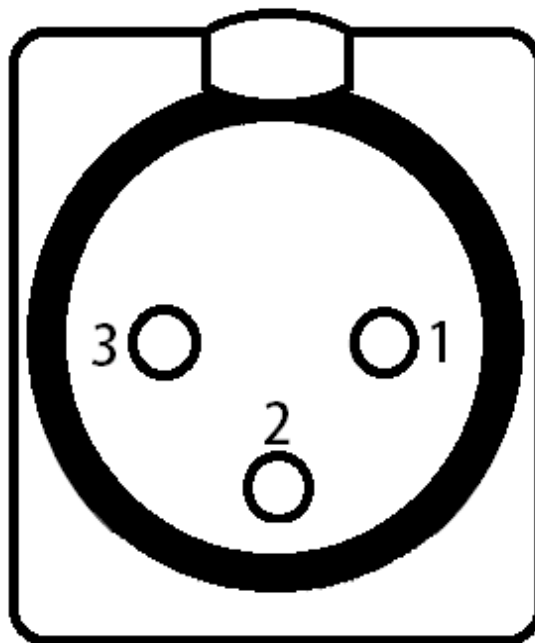

## Motor Feedback Connectors

The encoder and Halls signal cables plug into these connectors. The feedback connection is used by the servo drive to ensure the servo motor is in the commanded position. Each feedback connector is a DB-15 female connector. The pin assignments for the feedback connector are as follows:

Motor Feedback Connectors			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	HALL S2	9	HALL S1
2	ENC VCC	10	ENC GND
3	HALL S3	11	ENC CH Z+
4	ENC CH B-	12	ENC CH B+
5	ENC CH A-	13	ENC CH A+
6	ENC VCC	14	ENC GND
7	ENC CH Z-	15	N/C
8	N/C		

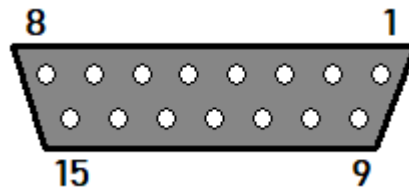

## Motor Signals


The Motor Signals connector uses a DB-25 connector to send step and direction signals from the FlashCut CNC Signal Generator to an external drive box.

The Motor Signals connector also provides a connection point to inputs 1-8 and outputs 1 & 2. Inputs 1-8 are the same signals found on the Input connector. Output 1 & 2 are the same outputs found on the output connector.

The Motor Signals connector can be used to tap into the internal +5V power supply as well as provide an externally isolated power supply for the inputs. Refer to the signal generator section of this hardware guide for further information on input voltage compatibility.

The voltage levels for each Output, Step, Direction and Enable signals are all 5V logic.

DB-25 Connector for Motor Signals			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	OUTPUT 1	14	ENABLE ALL
2	OUTPUT 2	15	INPUT 1
3	STEP AXIS 5	16	INPUT 2
4	DIRECTION AXIS 5	17	INPUT 3
5	INPUT 5	18	INPUT 4
6	INPUT 6	19	DIRECTION AXIS 4
7	INPUT 7	20	DIRECTION AXIS 3
8	INPUT 8	21	DIRECTION AXIS 2
9	DIRECTION AXIS 1	22	INTERNAL VCC +5V
10	STEP AXIS 4	23	OPT. VCC (INPUT)
11	STEP AXIS 3	24	INTERNAL GND
12	STEP AXIS 2	25	OPT. GND (INPUT)
13	STEP AXIS 1		

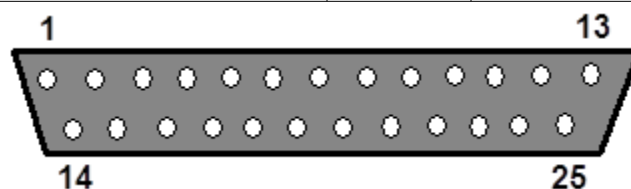

## USB


The USB connector is used for communication with the USB port on the host PC. Use a USB-A to B cable with a maximum length of 3 meters to make the connection. Plug the cable directly into PC, as opposed to a USB repeater or a hub. If the FlashCut software loses communication with the Signal Generator, electrical noise may be the cause. To reduce electrical noise problems, use a shorter USB cable or attach one or more ferrite chokes to the USB cable. Toroid-shaped chokes are more effective than snap-on cylindrical chokes. If you need more than 3m of USB cable length, use an active extension cable.

For the most robust USB connection, make sure the controller is communicating with the PC in Full-Speed mode rather than Hi-Speed mode. This setting can be found in the configuration dialog of your CNC software and will not decrease performance compared to Hi-Speed.

## Outputs

This connector is for up to eight output lines. The Output ports cannot drive a 24V external system unless it accepts TTL/CMOS levels. They are all driven by HCT family logic. Output logic high is normally 5V and can be as low as 3.9V at full load. Output logic low is normally 0V and can be as high as 0.3V at full load. Each of these signals can provide up to 20mA of current. Information about the mating connector can be found in the Signal Generator section.

10-Pin Mini-Fit Jr. Connector for Outputs			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	OUTPUT 1	6	OUTPUT 2
2	OUTPUT 3	7	OUTPUT 4
3	OUTPUT 5	8	OUTPUT 6
4	OUTPUT 7	9	OUTPUT 8
5	+5V	10	GND

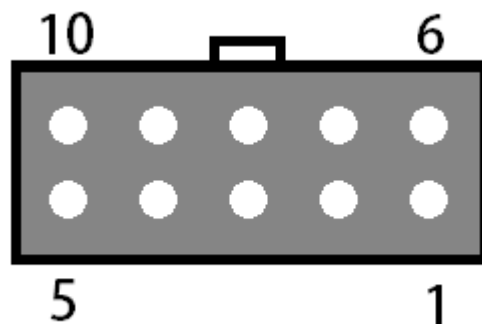


## Inputs

The input connector provides a connection point for up to eight input lines. The most common use of the input lines is for limit or safety switches. These lines are all TTL and CMOS compatible, optically-isolated inputs. When a switch is open, its input signal is high (5VDC). When the switch is closed, the input signal is grounded low (0VDC). If you need more than eight input lines, an I/O expansion board is available.

The input circuit can be configured to be compatible with higher voltages and optical isolation. NPN type proximity sensors are compatible with the input lines, but may require a different voltage to power. For configuration and mating connector information, refer to the Signal Generator section of this manual.

16-Pin Mini-Fit Jr. Connector for Inputs			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	OPT. GND	9	INPUT 1
2	OPT. GND	10	INPUT 2
3	OPT. GND	11	INPUT 3
4	OPT. GND	12	INPUT 4
5	OPT. GND	13	INPUT 5
6	OPT. GND	14	INPUT 6
7	OPT. GND	15	INPUT 7
8	OPT. GND	16	INPUT 8

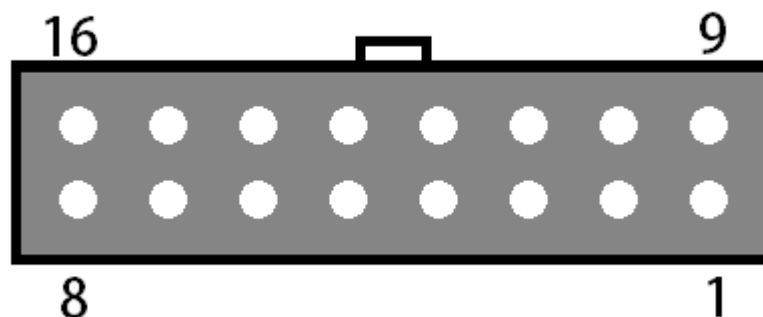

## Accessory Connector

The accessory connector is an interface to the emergency stop circuit, 24 VDC out, the reset circuit and two motor brakes. It is designed to connect external switches or circuits wired to the connector's screw terminals (Molex-Waldom part number 39530-0010). The pin-out can be seen below:

10-Pin Phoenix Connector for Accessory Signals			
Pin No.	Signal	Pin No.	Signal
1	ESTOP +	6	BRAKE1-
2	ESTOP-	7	BRAKE2+
3	+24V	8	BRAKE2-
4	GND	9	RESET+
5	BRAKE1+	10	RESET-



**Emergency Stop (Pins 1 & 2):** The emergency stop input can be used to disconnect power to the motor drivers in the event of an emergency using a normally closed switch. Make sure switch 6 on the power board is enabled. For further information on the power board, please see the section on the power board later in this guide.


**Switched 24V Supply (Pins 3 & 4):** The switched 24VDC supply can be used to indicate when the motor drivers are powered and ready to run. The supply will not output voltage until the emergency stop and reset circuits have been cleared.

**Brake Outputs (Pins 5 & 6; 7 & 8):** There are two 24VDC brake outputs to control motor brakes. When a brake output is active and supplying power, the brake rotates freely. For further information on triggering the brake output, please see the power board section of this guide.

**Reset (Pins 9 & 10):** The reset input can be used to clear an emergency stop condition. This requires the emergency stop button to be returned to a normal state. Power will then be restored to the motors when the reset input is tripped. To use the reset input, connect a normally open switch to pins 9 & 10 and turn on switch 1 on the power board. For further information, please see the section on the power board later in this guide.



## Connection Diagram

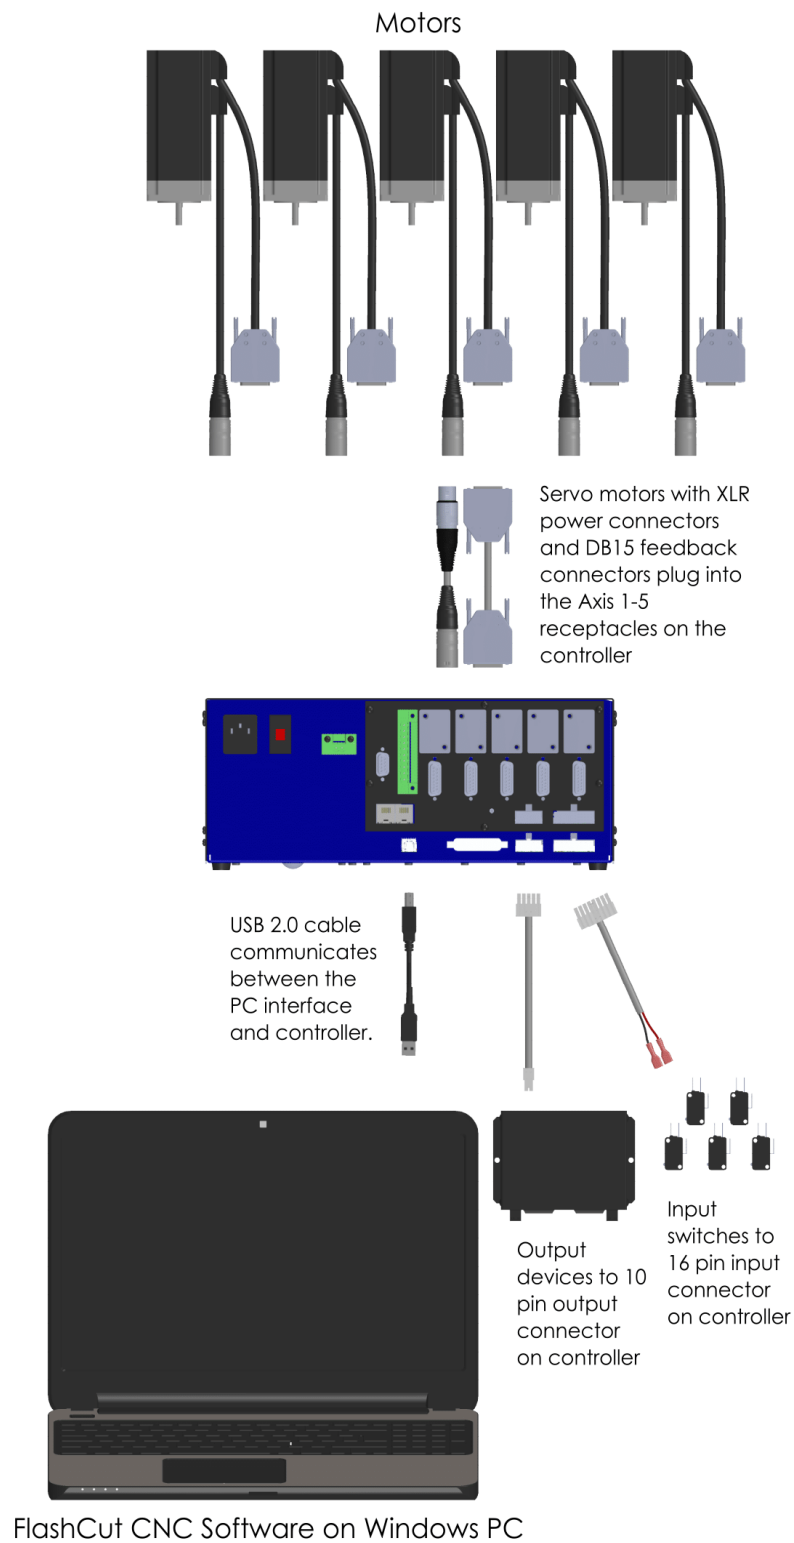


## Servo Motor Cabling

### *Power Cable and Wiring*

The cable used for stepper motor wiring should have three 18 AWG conductors with a foil shield and shield wire. Each conductor connects one leg in the motor to the servo drive. An example of appropriate cable is Alpha Wire P/N M4691. If the cable is an extension (between the controller and existing cabling), the shield wire should be terminated on both ends. If the cable is directly connected to the motor, the shield should only be terminated on the controller side. The mating connector is a male XLR3 (such as Neutrik P/N NC3MX).


XLR4 Connector for Motor Power	
<i>Pin No.</i>	<i>Signal</i>
1	Phase U
2	Phase V
3	Phase W

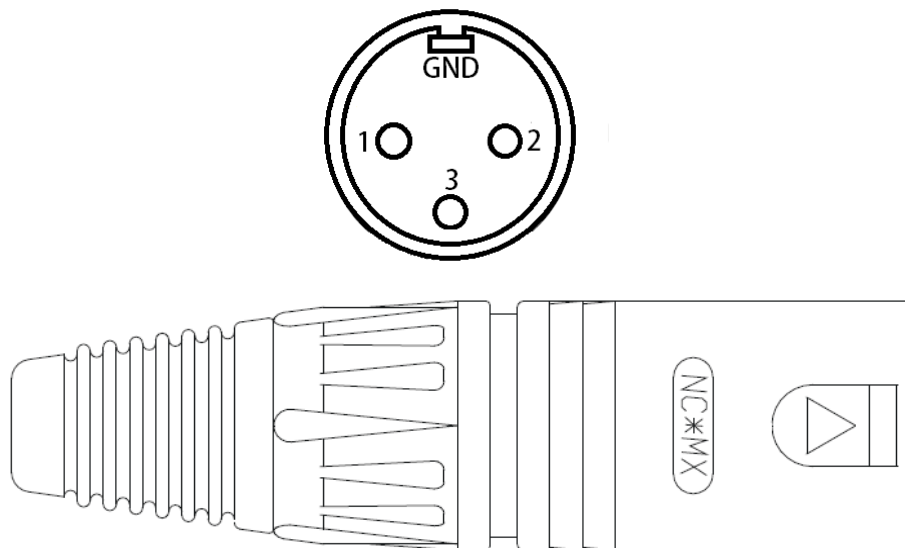

## Feedback Cable and Wiring


The cable used for stepper motor wiring should have seven 22 AWG pairs with a foil shield and shield wire. An example of appropriate cable is Alpha Wire P/N M5661. If the cable is an extension (between the controller and existing cabling), the shield wire should be terminated on both ends. If the cable is directly connected to the motor, the shield should only be terminated on the controller side. The mating connector is a male DB-15 (such as Neutrik P/N NC3MX).

Feedback Cable and Wiring			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	Hall S2	9	Hall S1
2	Encoder VCC	10	Encoder GND
3	Hall S3	11	Encoder Z+
4	Encoder B-	12	Encoder B+
5	Encoder A-	13	Encoder A+
6	Encoder VCC	14	Encoder GND
7	Encoder Z-	15	N/C
8	N/C		

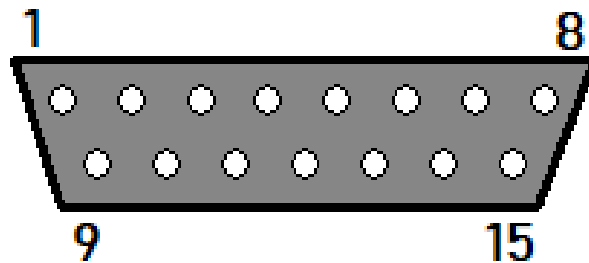

## Motor Drive Settings

Each drive has connections for control input from the Signal Generator, feedback input from the motor, motor power input, power output to phases A, B and C, communication ports, four indicator LEDs and a bank of dip switches for configuring the drive. Optionally, the drive may also have an auxiliary accessory port.

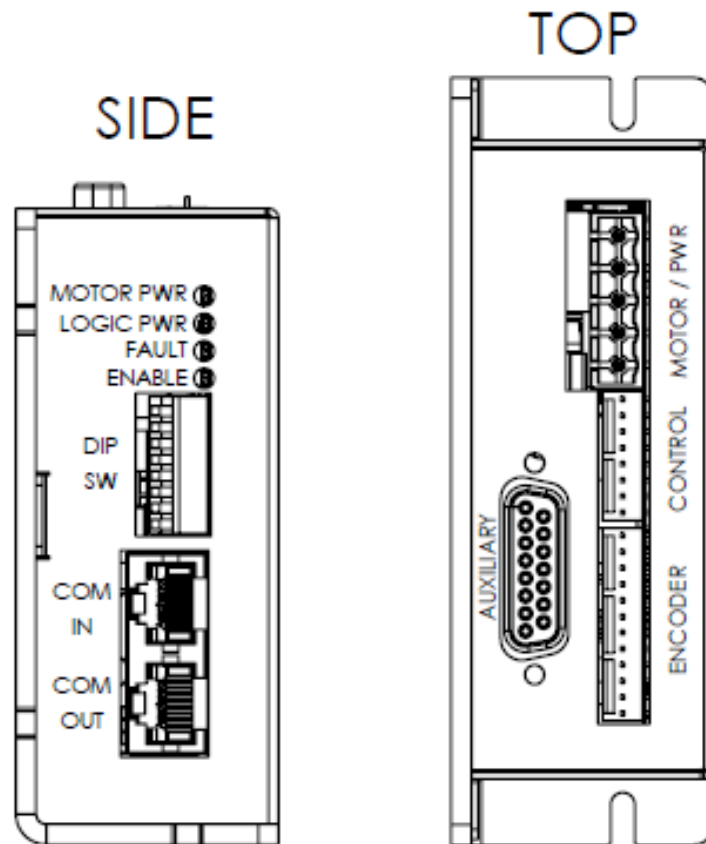


### Configuring the Drives

The drive features an RS-485 serial communication interface for drive configuration and setup. Drive tuning is accomplished using the ServoWare software. If there is an issue communicated with the drives, make sure that the communication patch cables are installed between all drives, that the dip switches are set appropriately and that the communication adapter is installed correctly.


## Launching ServoWare

The ServoWare software can be conveniently opened through the FlashCut software. Open the 'System Status' window and navigate to the "Utilities" tab. From here, click the link to run the latest version of ServoWare. If this is the first time running ServoWare, the installer will run instead. Once installed, ServoWare can also be launched from the Windows Start Menu.

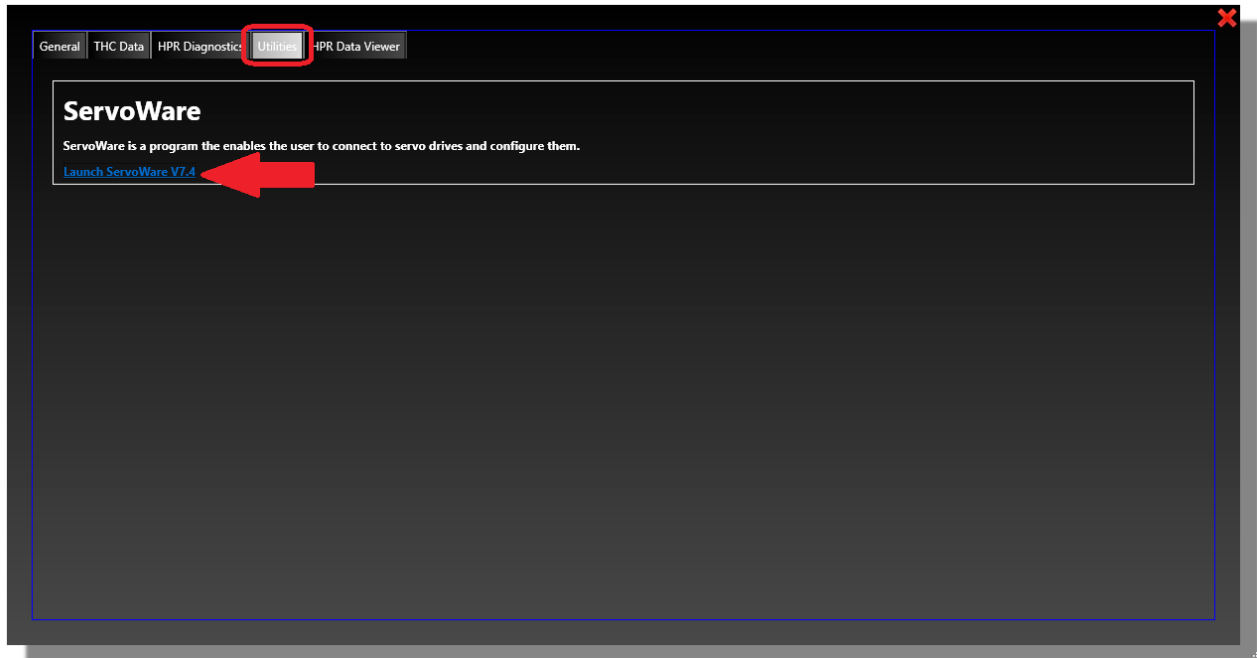

## Connecting to the Drives

Once ServoWare opens, you will be prompted to 'Open' or 'Connect'. Click 'Open' and navigate to the *Sample Projects* folder. Then, select the matching tuning file for the connected motor. Next, click 'Connect' from the toolbar. Set the interface to RS485 and Baud Rate to 115200. The Serial Port is dependent on which port Windows installed the communications device. This can be verified through the Windows Device Manager.


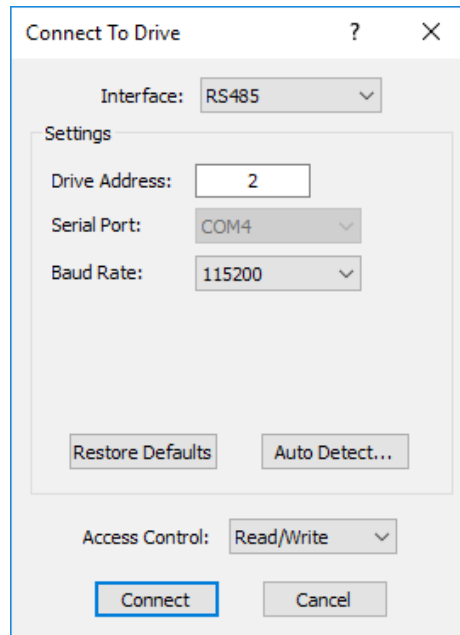


The address is dependent on the drive's dip switch settings. The default settings and addresses are shown in the following table.

<b>Address</b>	<b>Axis Num</b>	<b>Address</b>	<b>Axis Num</b>
2	Axis 1	16	Axis 4
4	Axis 2	18	Axis 5
5	Axis 3	20	Axis 6

## Saving the Configuration

Select 'Download' on the next window after initiating the connection. Then, click the 'Store' button on the toolbar to save the configuration to the drive's non-volatile memory (NVM).

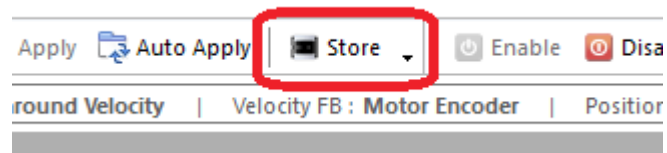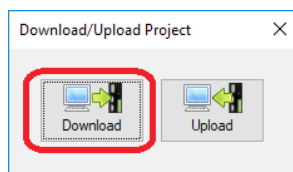

**Switches 1–4 (Address Setting)**

The following table shows the drive address based on the position of switches 1–4. Ensure that no two drives on the network are set to the same address. Please note that these switches must be set prior to power on. Changing the settings with power applied will not apply any changes. It is highly recommended that you use the default configuration shown previously in this section.

<b><i>Drive Address</i></b>	<b><i>SW1</i></b>	<b><i>SW2</i></b>	<b><i>SW3</i></b>	<b><i>SW4</i></b>
2	ON	OFF	OFF	OFF
4	OFF	ON	OFF	OFF
5	ON	ON	OFF	OFF
16	OFF	OFF	ON	OFF
18	ON	OFF	ON	OFF
20	OFF	ON	ON	OFF
21	ON	ON	ON	OFF
32	OFF	OFF	OFF	ON
34	ON	OFF	OFF	ON
36	OFF	ON	OFF	ON
37	ON	ON	OFF	ON
40	OFF	OFF	ON	ON
42	ON	OFF	ON	ON
44	OFF	ON	ON	ON
45	ON	ON	ON	ON
Programmed	OFF	OFF	OFF	OFF

**Switch 5 (Unused)**

This switch is not used at this time and should remain off.

**Switch 6 (Command Source)**


When switch 6 is off, the drive responds to Step/Dir signals from the Signal Generator. When this switch is on, the drive instead responds to command inputs on the auxiliary accessory connector. This mode is most commonly used for a 'slaved' drive to receive motion information from the 'master' drive.

**Switches 7&8 (Communication Termination)**

Switches 7&8 should both be set on for the last drive in the communication network. Generally, this is the drive with a single communication patch cable installed. If these are set on any other drive, communication issues will result.

***Indicator LEDs***

The servo drive is equipped with four LEDs to indicate status and operating state:

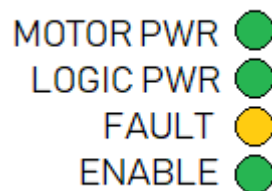**Motor Power**

Indicates the presence of input motor power when illuminated.

**Logic Power**

Indicates the presence of drive logic power when illuminated.

**Fault**

Indicates that the drive is inactive or disabled.

**Enable**

Indicates that the drive is both enabled and active.



## Auxiliary Accessory Connector

This DB-15 connector provides access to several input and output signals on the drive. Its primary applications are encoder following and brake signals, detailed below.

<b>Auxiliary Accessory Connector</b>			
<b>Pin No</b>	<b>Signal</b>	<b>Pin No</b>	<b>Signal</b>
1	Analog Input 1+	9	Analog Input 1-
2	GND	10	Aux Input 5+
3	Aux Input 4+	11	Input 2
4	Output 2	12	Output 3
5	Input 3	13	Output 1
6	Encoder Ch A Output	14	Encoder Ch B Output
7	N/C	15	N/C
8	N/C		

## Encoder Following Cable

This cable is used between a master and slave drive pair to communicate position commands.

<b>Encoder Following Cable</b>			
<b>Master</b>		<b>Slave</b>	
<b>Pin No</b>	<b>Signal</b>	<b>Pin No</b>	<b>Signal</b>
2	GND	2	GND
6	Encoder Ch A Output	3	Aux Input 4+
14	Encoder Ch B Output	11	Input 2

## Brake Signal Cable


This cable is used to send a deactivation signal to the power board to disable a brake.

<b>Brake Signal Cable</b>			
<b>Drive Aux</b>		<b>Power Board P701/P702</b>	
<b>Pin No</b>	<b>Signal</b>	<b>Pin No</b>	<b>Signal</b>
2	GND	1	GND
13	Output 1	2	BRAKE IN

## FlashCut CNC Software Configuration

### Motor Signal Setup

In FlashCut CNC, go to “System...Controller” in the configuration and make sure the 25A Pro Series Servo controller is selected.

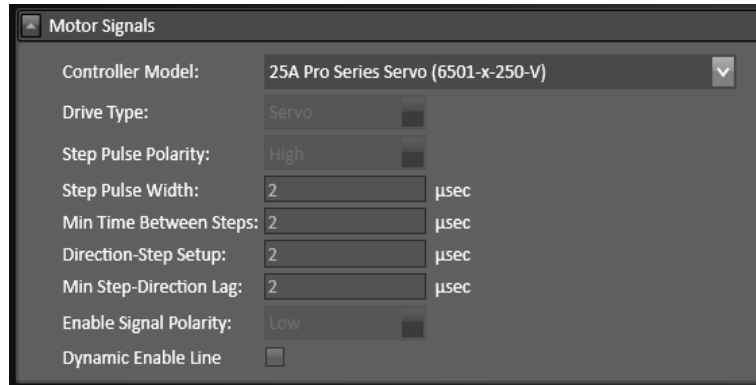

### Input Line Setup

If the drive encounters an electrical problem that prevents it from functioning, it will enter a fault state. If this occurs, a fault signal will be sent from the servo motor drive to the Signal Generator through one of the input lines.

To configure these faults to stop the software in the case of a servo drive fault go to “I/O...Input Lines” and define Function of the lines you are using for servo faults as Safety and Wiring as N.C. This signal is automatically routed to the Signal Generator via the internal control cables.



**If you are using input lines, do not occupy inputs 9, 11, 13, 15 or 17 as a conflict will occur and the input connected to these lines will malfunction and may damage the controller.**

<i>Line #</i>	<i>Description</i>	<i>Function</i>	<i>Wiring</i>
9	Axis 1 Fault	Safety	N.C.
11	Axis 2 Fault	Safety	N.C.
13	Axis 3 Fault	Safety	N.C.
15	Axis 4 Fault	Safety	N.C.
17	Axis 5 Fault	Safety	N.C.



## Tuning and Commutation

Once connected to a drive through ServoWare, manual drive tuning can be performed. Drive tuning is a multi-step process that involves proper tuning of three different servo loops. This section shows how to tune a Brushless DC servo motor equipped with hall sensors and an incremental encoder. Three servo loops will be tuned, as follows: Current, Velocity and Position.



**Before tuning, the drive MUST have the appropriate motor parameters and limits configured.**

**1. Current Loop Tuning:** Once the drive parameters are configured properly, the current loop must be tuned. You can select to have the current loop gains calculated based on motor data. This will typically provide a good starting point although some applications may require further refinement of the tuning parameters. If you calculate the current loop gains, it is recommended that you verify the operation at currents throughout the motor's operating range.

**2. AutoCommutation™:** This routine collects data on the motor and feedback parameters and prompts the user to verify that they match what is entered into the Motor Data page.

The motor MUST be free of mechanical load during auto-commutation.

**3. Velocity Loop Tuning:** A very tight current loop inside of a relatively tight velocity loop may cause audible noise. If maximum bandwidth is not necessary, de-tuning the current loop usually removes most of the audible noise. The velocity loop will have to be adjusted any time the current loop tuning is changed.

**4. Position Loop Tuning:** For the best positional accuracy, the position loop will be tuned around the velocity loop.

## Current Loop Tuning




**Make sure that the motor is free to move and decoupled from the load, as sudden motion may occur.**

### Inputs/Outputs Configuration Setup

Configure the User Disable function for proper operation in the system. (Set User Input 1 to General Purpose, Active Low with User Disable, Reset Events and Set Position functions).

### Waveform Generator Setup

1. Open the Scope/Tuning tab by clicking on the 'Scope/Tuning' icon  from the toolbar.
2. In the Waveform Generator pane, select the waveform Target as Current Loop.
3. Select the Square waveform Type.
4. Set Frequency (Freq) to 100 Hz. If your motor has low inertia and is very responsive, use 150 Hz or 200 Hz.
5. Ensure Offset is zero.
6. Ensure Symmetry (Sym) is 50%.
7. Set the waveform Amplitude (Ampl) to an appropriate value. Begin with 10% of the drive continuous current rating or 50% of the motor continuous current rating, whichever is lower.
8. Click the 'ON' button to turn on the Waveform Generator.


### Oscilloscope Setup

Select the Current oscilloscope preset from the Presets drop-down menu in the Scope/ Tuning tab or manually configure the settings by following the steps below:


1. Change the channel 1 signal to Current Target.
2. Change the channel 2 signal to Current Measured.
3. Change the Trigger Source to Current Target with the Level set to zero.
4. Ensure Trigger Mode is Normal.
5. Change Time/Div to either 1 msec or 500 usec.

## Tuning

1. With the Scope/Tuning window still open, select "Tuning....Current" Loop Gains from the System Browser.
2. To set starting values for the Current (Torque) Loop proportional ( $K_p$ ) and integral ( $K_i$ ) gains, click the Calculate button to calculate gains that utilize the values entered into the Motor Parameters, Feedback and Limits windows. The specified motor inductance, resistance and bus voltage determine the accuracy of the calculated values.
3. Enable the drive by clicking the Enable icon. The motor should emit an audible noise but remain still.
4. Proper current loop tuning starts with zero integral gain while increasing the proportional gain until a 'knee' is formed (with no overshoot) in the Current Measured trace.

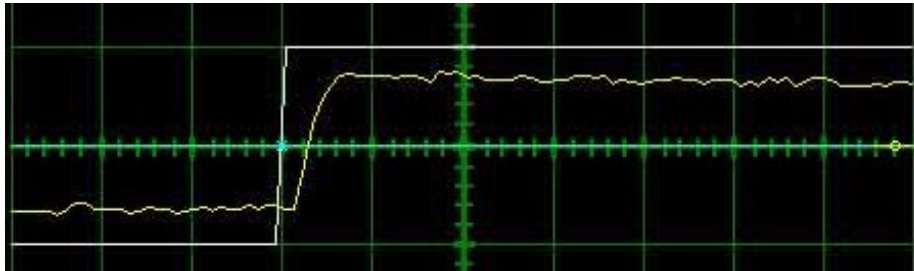

5. At this point, the proportional gain is done and the Integral gain must be slowly increased to close the steady state error between the Current Target and Current Measured traces.

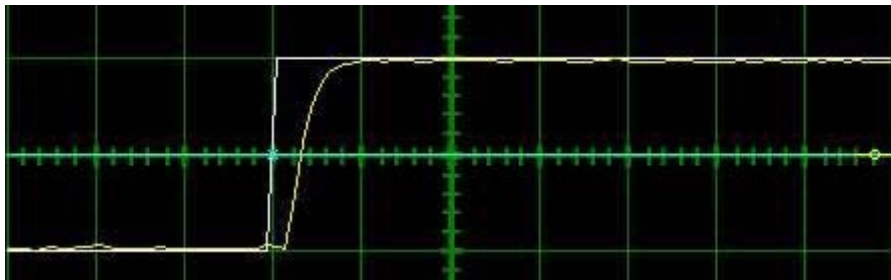

6. Tuning changes with signal amplitude. You should now re-adjust the current amplitude in the Waveform Generator tab according to your most common application current requirements and re-tune. Contouring applications generally use small signal transients while point-to-point applications use larger signal transients.
7. When current loop gain adjustments are complete, disable the drive.
8. Turn off the Waveform Generator to remove the command signal from the drive by clicking the 'OFF' button in the Waveform Generator pane.
9. Click 'Store' on the toolbar to store the parameters to the drive's nonvolatile memory.

## Commutation

Commutation of a servo motor is the process that maintains an optimal angle between the permanent magnet field and the electromagnetic field created by the motor current(s). This process ensures optimal torque or force generation at any motor position—regardless of speed—for brushless motors.

Most applications use the AutoCommutation routine for configuring a drive to a specific motor. This routine will detect the feedback devices attached to the motor and ask the user to verify them against the motor's datasheet.

### AutoCommutation™



***Before you run AutoCommutation, be sure you:***

- Enter in the correct motor information in the Motor window page.
- Specify the correct feedback information.
- Specify limits to protect the motor.
- Tune the current loop.
- Decouple the motor from any load and secure the motor. Sudden motion will occur!

1. In Motor > Parameters, ensure that Sinusoidal Commutation is selected in the Commutation section of the window.
2. Open the AutoCommutation window ('Motor....AutoComm').
3. Enable the drive if it is not enabled.
4. Click 'Start AutoCommutation' to begin the process. Observe the motion traveled.
5. Rotary motors should turn 2.25 revolutions in each direction.
6. When AutoCommutation is complete, select whether the motor has moved the proper distance or has not moved the proper distance. If the motor did not rotate as expected, verify the motor parameters.
7. Once the motor has properly completed the AutoCommutation routine, verify the proper commutation and synchronization settings:
  - Commutation: It is recommended to select trapezoidal commutation. This will allow another motor of the same model to be connected to a drive and be used without performing the AutoCommutation procedure again.
    - Trapezoidal: The drive uses Hall Sensors to commute trapezoidally.
  - Synchronization: It is recommended that None be selected.
    - None: No synchronization is performed.
8. Click 'Apply' from the toolbar to save the AutoCommutation parameters.

9. Click the 'Store' icon to store parameters to non-volatile memory.

**AutoCommutation™ Warnings**

After running AutoCommutation, warnings may appear due to wiring errors or discrepancies between the information on the "Motor Data" page and the results of AutoCommutation.

Review the results and highlight any differences between what AutoCommutation detected and what was configured in the "Motor Parameters".




## Velocity Loop Tuning

Tuning of the velocity loop should only be performed after current loop tuning and motor commutation. Velocity loop tuning is dependent on the mechanical load, and therefore will change with any mechanical system changes. Velocity loop tuning should be performed with the motor installed in the system and connected to the load. Make sure that the load is free to move as sudden motion may occur. For velocity loop tuning, the 'Loop Configuration' setting in the active Configuration must be set to either Velocity or Position around Velocity.

It is recommended to disable the drive by clicking on the 'Disable' icon on the toolbar before beginning tuning. The procedure below will prompt you to enable the drive when necessary for tuning.

### Waveform Generator Setup

1. Open the Scope/Tuning tab by clicking on the 'Scope/Tuning' icon  from the toolbar.
2. Select the waveform Target as Velocity Loop.
3. Select the Square waveform Type.
4. Set Frequency to around 1-3 Hz. The frequency should be slow enough to achieve commanded velocity, but fast enough to prevent the system from reaching a mechanical limit.
5. Ensure Offset is zero.
6. Ensure Symmetry is 50%.
7. Set the waveform Amplitude to approximately 10% of motor nominal speed.
8. Click the 'ON' button to turn on the Waveform Generator.


### Oscilloscope Setup

Select the Velocity Scope Preset or manually configure the settings by following the steps below:


1. Change the channel 1 signal to Velocity Target.
2. Change the channel 2 signal to Velocity Measured.
3. Change the Trigger Source to Velocity Target with the Level set to zero.
4. Ensure Trigger Mode is Normal.
5. Change Time/Div to 10-20msec. The Scale on the display will need to be adjusted accordingly for each trace.

## Tuning

1. With the Scope/Tuning tab still open, select either "Tuning....Gain Set 0" or "....Gain Set 1" from the System Browser depending on which Gain Set is currently used for the active Configuration.
2. Begin by setting all the velocity loop gains to zero (Kp-Proportional, Ki-Integral, Kd-Derivative, Aff-Feedforward).
3. Enable the drive by clicking the 'Enable' icon.
4. Proper Velocity loop tuning starts with zero integral gain while increasing the proportional gain until a "knee" is formed (with no overshoot) in the Velocity Measured trace, as shown below. There may or may not be an error between the Target and Measured traces; the key is to have a smooth knee shape.

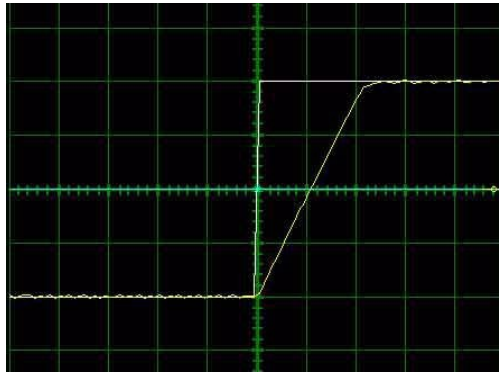

5. At this point, the proportional gain is left alone and the integral gain is increased slowly until the "knee" begins to deform as shown below. It's okay if the waveform does not start to distort until the integral gain is very high. When the distortion occurs, back off the Integral gain until the knee becomes smooth again.

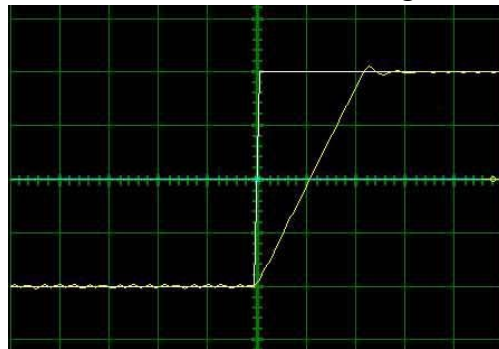

6. Next, in order to improve the smoothness of the response, it may be beneficial to adjust the velocity feedback filter cutoff frequency in the "Tuning....Filters" window. The Filter Frequency is used to dampen oscillations and noise in the velocity measurements. For most systems, the ideal cutoff frequency will be somewhere between 50Hz and 1500Hz.
7. Most systems will be tuned properly at this point. If your system requires fine-tuning, you may adjust the derivative and feed-forward gains. If the motor starts to make audible noise, increase the Low Speed Smoothing in the Loop Filters window until the vibration and noise stops.

8. When tuning is complete, disable the drive by clicking the 'Disable' icon on the toolbar. Turn off the Waveform Generator by clicking the 'OFF' button in the waveform generator pane.
9. Click 'Store' on the toolbar to store the parameters to the drive's nonvolatile memory.


## Position Loop Tuning

Position loop tuning is dependent on the mechanical load and therefore will change with any mechanical system changes. Position loop tuning should be performed with the motor installed in the system.



**It is recommended to disable the drive by clicking on the 'Disable' icon on the toolbar before beginning tuning. The procedure below will prompt you to enable the drive when necessary for tuning.**

### Waveform Generator Setup


1. Open the Scope/Tuning tab by clicking on the Scope/Tuning icon  from the toolbar.
2. Select Position Loop as the waveform Target.
3. Select the Square waveform Type.
4. Set Frequency to around 1-3 Hz. The Frequency should be slow enough to allow the motor to settle in position.
5. Set Offset to zero.
6. Ensure Symmetry is 50%.
7. Leave the Amplitude at zero for the moment.
8. Click the ON button to turn on the Waveform Generator

### Oscilloscope Setup

Select the Position Scope Preset or manually configure the settings by following the steps below:

1. Change the channel 1 signal to Position Target.
2. Change the channel 2 signal to Position Measured.
3. Change the Trigger Source to Position Target with the Level set to zero.
4. Ensure Trigger Mode is Normal.
5. Change Time/Div to 20-50 msec. The Scale on the display will need to be adjusted accordingly for each trace.

## Tuning

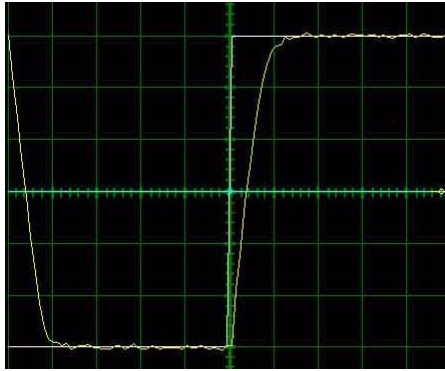

1. With the Scope/Tuning window still open, select "Tuning....Gain Set 0".
2. In the Gain Set tab, set all gains to zero (Kp-Proportional, Ki-Integral, Kd-Derivative, Vff-Velocity Feedforward, and Aff-Acceleration Feedforward).
3. The Set Position function is used to set the measured and target position to the value defined in the Preset Position field. It is recommended to set the Preset Position to zero before beginning tuning to avoid any unexpected jumps when the drive is enabled. Enter "0" in the Preset Position field and then click the Set button.
4. Enable the drive by clicking the 'Enable' icon. Set the waveform Amplitude between 1/8 and 1/2 revolution (between 500 and 2000 encoder counts) for a rotary motor. Use the Proportional Gain, Integral Gain and Derivative Gain sliders or arrow buttons in the Position Loop window to adjust the Position Measured waveform on the oscilloscope and match the Position Target as closely as possible without excessive overshoot. Proportional Gain, Integral Gain and Derivative Gain should be adjusted in that order. It is not necessary to adjust the Velocity or Acceleration Feed-forward Gains.
5. Readjust the Gains as Necessary.
6. When position loop gain adjustments are complete, disable the drive by clicking the Disable icon on the toolbar. Turn off the Waveform Generator by clicking the OFF button in the waveform generator pane.
7. Click the Store icon on the toolbar to store parameters to the drive's nonvolatile memory.

## ***Velocity Feedback Filter***

The velocity loop feedback filter uses a single pole low-pass filter to attenuate changes in velocity feedback. This helps to avoid responding to high frequency “spikes” in velocity, resulting in a smoother response to velocity commands.

### **Effects of the Feedback Filter**

**Cutoff Frequency Set to Infinite:** With no feedback filter, the velocity measured and velocity feedback are equal. The velocity loop responds instantly to all measured changes in velocity. The resulting velocity profile is distorted. A loud audible noise is heard from the motor.

**Cutoff Frequency Set to 300Hz:** At this level, the audible noise is no longer present and the response is smooth. The two waveforms are nearly identical. This is the optimum setting because it results in no distortion and no phase lag.

**Cutoff Frequency Set to 50Hz:** At this level, the response is still smooth, but phase lag is apparent as the two waveforms begin to separate.

**Cutoff Frequency Set to 10Hz:** With the cutoff frequency set to 10Hz, there is an obvious difference between the two waveforms. The response is also noticeable in the motor shaft. The phase lag results in the motor motion becoming unstable.

### **Filtering Results**

The velocity loop cutoff frequency filter allows you to tune with higher velocity loop gains, which results in a faster response. Most applications will benefit from a velocity feedback filter cutoff frequency between 50Hz and 1500Hz. Too high of a cutoff frequency may result in audible noise from the motor. Too low of a cutoff frequency will cause significant phase lag and may lead to instability. The cutoff frequency should be adjusted during velocity loop tuning. For the worst-case move, the motor should follow the command smoothly and there should be little or no phase lag between the velocity feedback and velocity measured traces.

# Signal Generator

## LEDs

The Signal Generator has seven LED indicators on-board to show different states of the system.

### Power-On Sequence


When power is first applied to the Signal Generator, the seven LED indicators go through a start-up sequence to indicate that the firmware is in a healthy state. First, all LEDs blink once. Then, each LED blinks once in order from Axis 1 to Power.

After the light sequence is complete, Axis 1-5 LEDs will remain off and the Power LED will be on. The USB LED will be on if a USB cable is connected between the controller and PC, otherwise the USB LED will be off.

If the LEDs do not sequence on power-up as described, either there is no power to the Signal Generator or the firmware on the controller has become corrupted and the controller will need to be repaired.

### During Operation

Each Axis LED will pulse when its corresponding axis is commanded to move. This causes the LED to appear to increase in brightness as the commanded motion becomes faster.

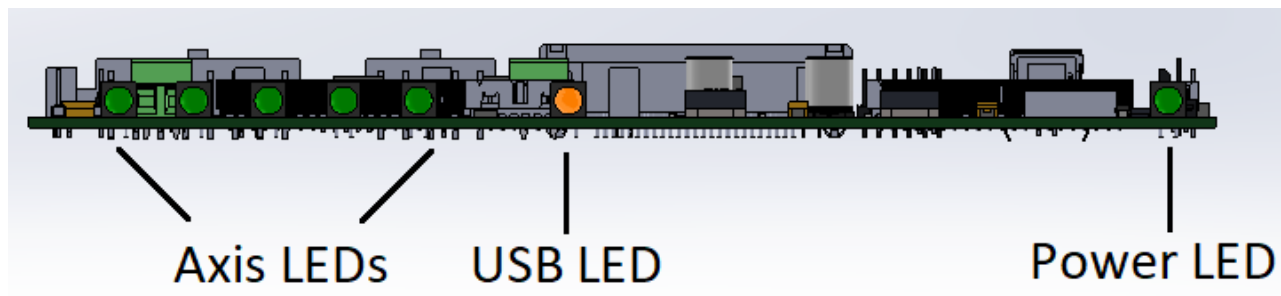

## **Inputs**

Inputs 1-8 are all optically isolated to provide a measure of protection from overvoltage and transient voltages. The inputs' reference voltage can be supplied by the Signal Generator's internal logic power or by an external voltage wired to the Signal Generator's TB40.

### **Internal Power**

This option works well for most applications but negates some of the signal isolation. When JP84 shorts pins 1 and 2, OPT VCC gets its power from the internal 5V power source. When JP85 shorts pins 1 and 2, OPT GND is directly connected to the internal GND.

### **External Isolated Power**

For the best noise immunity, connect an external 5V-24V power supply using one of the following methods. This is the default configuration. Ensure that all of your input devices are compatible with the supplied voltage. When JP84 shorts pins 2 and 3, OPT VCC gets its power from the TB-VCC. When JP85 shorts pins 2 and 3, OPT GND is directly connected to the TB-GND.

Choose only one of the following methods to supply power:

- Connect a power source to the TB-40 screw terminal.
- Connect a power source through pins 23 & 25 of the DB-25 connector.




**If you are providing an external voltage through pins 23 & 25 of the DB-25 Motor Signals connector or via TB-40, then you must have both JP84 & JP85 jumpers on pins 2 & 3. OTHERWISE, SEVERE DAMAGE COULD RESULT.**



The input line settings can be individually changed between normally closed (N.C.) or normally open (N.O.) input lines using FlashCut CNC software. Please refer to the FlashCut CNC User's Guide under "Input Line Settings" for further information. In the FlashCut CNC software, the Input Line Status dialog displays "OPEN" for a high-level input voltage, or open switch, and "CLOSED" for a low-level input voltage or closed switch. Each of these inputs are also accessible on the Motor Signals connector. These are the same—electrically—between this location and the Motor Signals connector.

The receptacle that plugs into this connector is a Mini-Fit Jr. Series 16 pin receptacle (Molex part number 39-01-2100), with female pins (Molex part number 39-00-0039 or 39-00-0047 for 22 gauge or thinner wires). The Molex 63819-0901 crimp tool is recommended for installing the pins. Kits containing connectors and pins are available through FlashCut CNC or an electronics distributor.

<b>16-Pin Mini-Fit Jr. Connector for Inputs</b>			
<b><i>Pin No.</i></b>	<b><i>Signal</i></b>	<b><i>Pin No.</i></b>	<b><i>Signal</i></b>
1	OPT. GND	9	INPUT 1
2	OPT. GND	10	INPUT 2
3	OPT. GND	11	INPUT 3
4	OPT. GND	12	INPUT 4
5	OPT. GND	13	INPUT 5
6	OPT. GND	14	INPUT 6
7	OPT. GND	15	INPUT 7
8	OPT. GND	16	INPUT 8

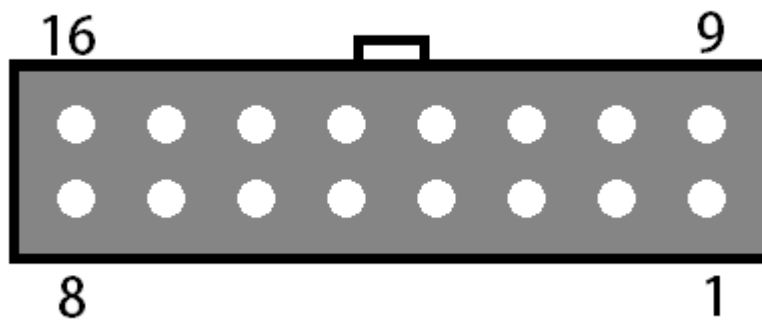

## Outputs


This connector is for up to eight output lines. These lines are all compatible with TTL/CMOS level outputs. The Output ports cannot drive a 24V external system unless it accepts TTL/CMOS levels. They are all driven by HCT family logic. Output logic high is normally 5V and can be as low as 3.9V at full load. Output logic low is normally 0V and can be as high as 0.3V at full load. Each of these signals can provide up to 20mA of current.

Two additional pins on this connector are provided for your output lines: ground and +5V. These are connected to GND and +5V and are not optically isolated. This 5V circuit can source up to 100 mA. Any larger current demand requires a larger power source.

The output lines are all initialized to low (0V) when you turn on the Signal Generator. Output lines 1 and 2 are also connected through pins 1 and 2, respectively, of the Motor Signal connector. These are the same—electrically—between this location and the Motor Signals connector.

The receptacle that plugs into this connector is a Mini-Fit Jr. Series 10 pin receptacle (Molex part number 39-01-2160), with female pins (Molex part number 39-00-0039 or 39-00-0047 for 22 gauge or thinner wires). The Molex 63819-0901 crimp tool is recommended for installing the pins. Kits containing connectors and pins are available through FlashCut CNC or an electronics distributor.

10-Pin Mini-Fit Jr. Connector for Outputs			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	OUTPUT 1	6	OUTPUT 2
2	OUTPUT 3	7	OUTPUT 4
3	OUTPUT 5	8	OUTPUT 6
4	OUTPUT 7	9	OUTPUT 8
5	+5V	10	GND

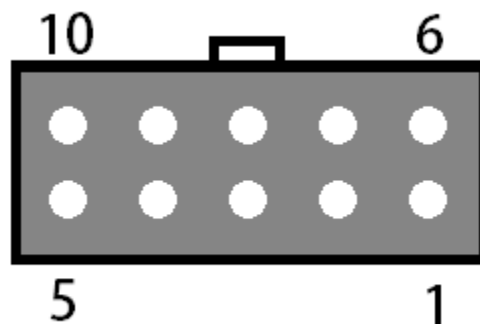

## Motor Signals


The Motor Signals connector uses a DB-25 connector to send step and direction signals from the FlashCut CNC Signal Generator to an external drive box.

The Motor Signals connector also provides a connection point to inputs 1-8 and outputs 1 & 2. Inputs 1-8 are the same signals found on the Input connector. Output 1 & 2 are the same outputs found on the output connector.

The Motor Signals connector can be used to tap into the internal VCC +5V power supply on the signal generator as well as provide an externally isolated power supply for the inputs. Refer to the signal generator section of this hardware guide for further information on input voltage compatibility.


The voltage levels for each Output, Step, Direction and Enable signals are all 5V logic.

DB-25 Connector for Motor Signals			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	OUTPUT 1	14	ENABLE ALL
2	OUTPUT 2	15	INPUT 1
3	STEP AXIS 5	16	INPUT 2
4	DIRECTION AXIS 5	17	INPUT 3
5	INPUT 5	18	INPUT 4
6	INPUT 6	19	DIRECTION AXIS 4
7	INPUT 7	20	DIRECTION AXIS 3
8	INPUT 8	21	DIRECTION AXIS 2
9	DIRECTION AXIS 1	22	INTERNAL VCC +5V
10	STEP AXIS 4	23	OPT. VCC (INPUT)
11	STEP AXIS 3	24	INTERNAL GND
12	STEP AXIS 2	25	OPT. GND (INPUT)
13	STEP AXIS 1		

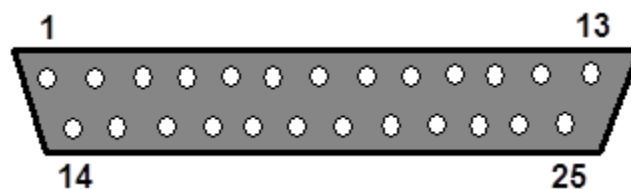

## Jumper Settings

Pin 1 of each jumper can be identified by a small, white dot printed on the PCB. A complete description of all jumpers and pin assignments can be found in the Wiring Appendix.

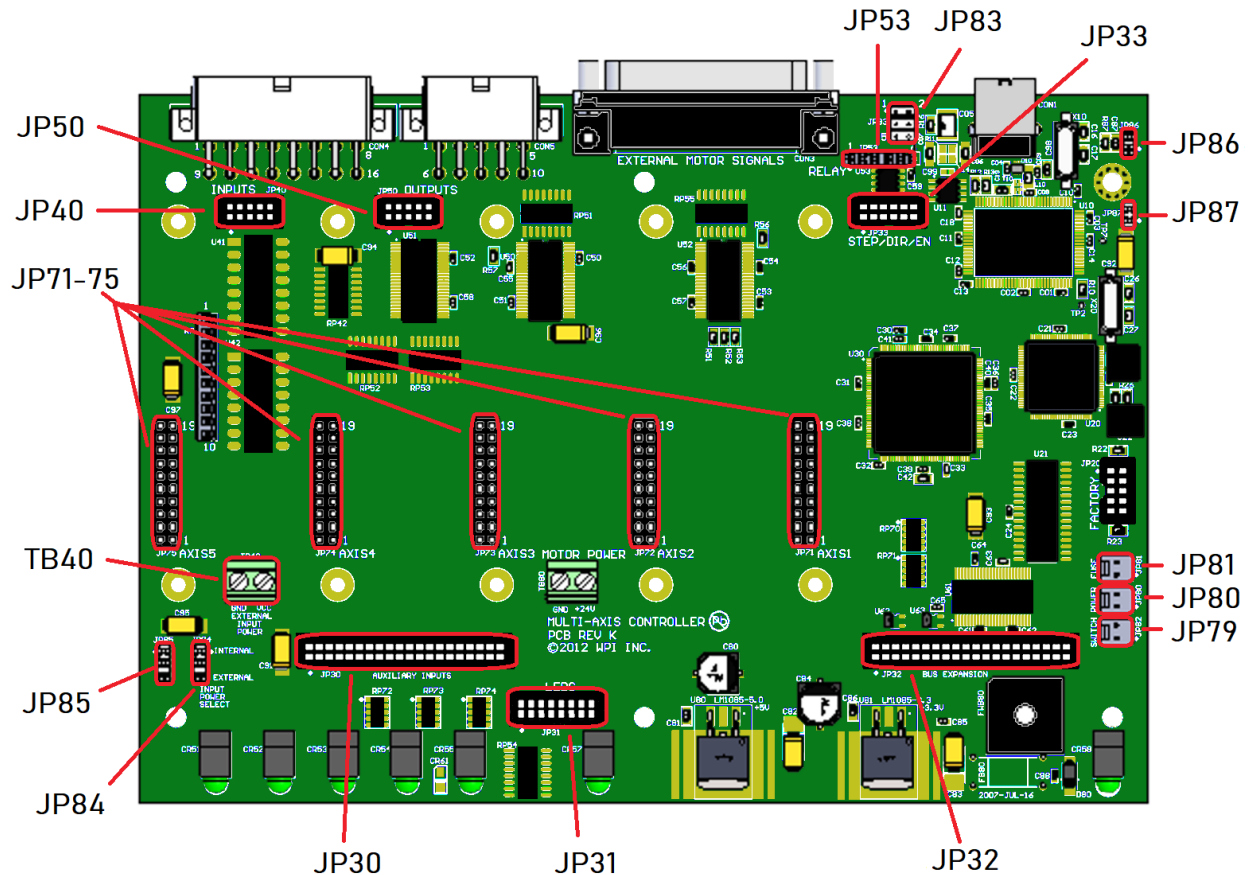

### JP83 – DB to USB Ground

This connects the DB-25 ground to the USB ground. By default pins 1 & 2, 3 & 4, and 5 & 6 are jumped as pairs. In order to isolate only the USB shield, only jump pins 3 and 5 and remove JP86. To isolate only the chassis, jump pins 1 & 2, 3 & 5 and 4 & 6 and remove JP86 and JP87. For further information, please see the USB Communications Troubleshooting Guide.


1	2
---	---

3	4
---	---

5	6
---	---

### JP84/JP85 – Input Power Select

These two jumpers enable you to choose between the internal power of the Signal Generator and isolated power from an external source. Both jumpers must be set on the same pair of pins (either both must be on pins 1 & 2 or both must be on pins 2 & 3). See the Input section of this guide for further details.

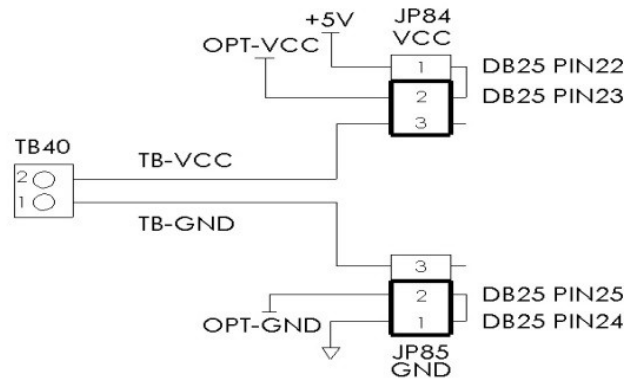

### JP86 – USB to Chassis Ground

This jumper connects the USB shield to the chassis ground of the Signal Generator when jumped. In order to isolate the USB shield remove this jumper and make sure only pins 3 and 5 are jumped on JP83. In order to isolate the DB-25 the USB shields, remove this jumper. In order to isolate the DB-25 shield, the USB shield and the chassis remove this jumper as well as JP87.

### JP87 – Internal Signal to Chassis Ground


This jumper connects the internal signal ground to the chassis ground of the Signal Generator when jumped. In order to isolate the chassis ground, remove this jumper in addition to JP86 and jump pin 3 and 5, and 4 and 6 on JP83. In order to isolate the DB-25 shield, the USB shield and the chassis, remove this jumper as well as JP86.

## Internal Connections

### JP30 – Auxiliary Input

This header contains the input signals from the Signal Generator for optional I/O Expansion. Connections should be made with approved peripherals, otherwise damage may occur.


JP30 – Auxiliary Input			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	+3.3V	21	GPI-24
2	+3.3V	22	GPI-9
3	GPI-32	23	GPI-23
4	GPI-1	24	GPI-10
5	GPI-31	25	GPI-22
6	GPI-2	26	GPI-11
7	GPI-30	27	GPI-21
8	GPI-3	28	GPI-12
9	GPI-29	29	GPI-20
10	GPI-4	30	GPI-13
11	GPI-28	31	GPI-19
12	GPI-5	32	GPI-14
13	GPI-27	33	GPI-18
14	GPI-6	34	GPI-15
15	GPI-26	35	GPI-17
16	GPI-7	36	GPI-16
17	GPI-25	37	+3.3V
18	GPI-8	38	+3.3V
19	GND	39	GND
20	GND	40	GND

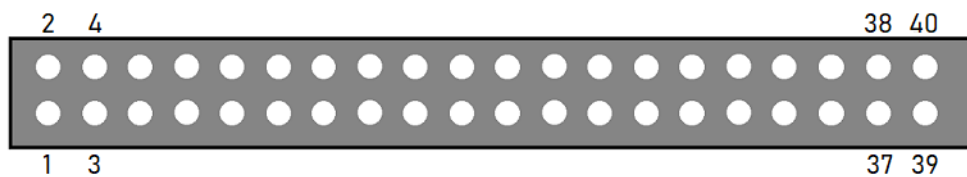

## JP31 – Status LEDs

This is for connecting wired LEDs from a custom chassis to the 501A LED signals.


JP31 – Status LEDs			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	+5V	9	LED-DIR4
2	N/C	10	LED-STEP4
3	LED-DIR1	11	LED-DIR5
4	LED-STEP1	12	LED-STEP5
5	LED-DIR2	13	LED-AUX
6	LED-STEP2	14	LED-USB
7	LED-DIR3	15	GND
8	LED-STEP3	16	LED-PWR

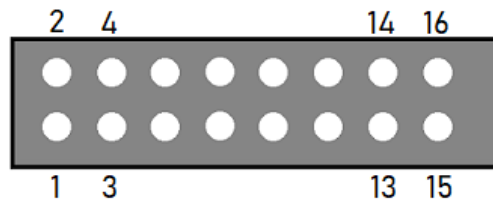

## JP32 – Bus Expansion

This header contains signal and address lines for an optional I/O Expansion board. Connections should be made with approved peripherals, otherwise damage may occur.

JP32 – Bus Expansion			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	+3.3V	21	DATA1
2	GND	22	DATA2
3	CS6	23	DATA3
4	STATUS6	24	DATA4
5	TXD2	25	DATA8
6	FAULT6	26	DATA7
7	RXD2	27	DATA6
8	AUX1-STB	28	DATA5
9	OUT-ENA	29	+7V
10	AUX2-STB	30	+7V
11	OUT2-STB	31	SPHOME
12	OUT1-STB	32	ENC CLK
13	OUT4-STB	33	+3.3V
14	OUT3-STB	34	ENC DIR
15	+5V	35	AGND
16	+5V	36	AV+
17	GND	37	DAC2
18	GND	38	DAC1
19	A0	39	ADC1
20	A1	40	AGND

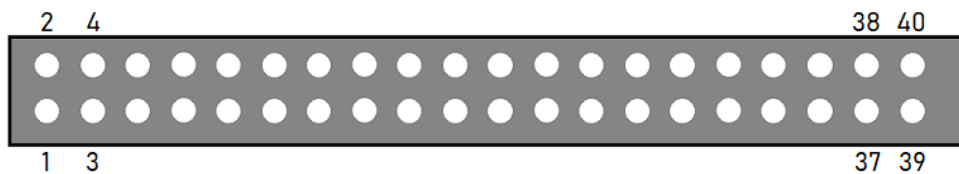




### JP33 – Step and Direction

This header contains each step and direction signal for all five axes of motion as well as the global enable signal and the common ground reference.


JP33 – Step and Direction			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	STEP5	7	STEP2
2	ENA	8	DIR3
3	STEP4	9	STEP1
4	DIR5	10	DIR2
5	STEP3	11	GND
6	DIR4	12	DIR1

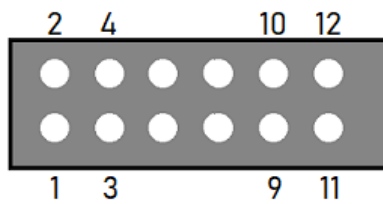

## JP40 – Input Aux

This header contains the same signals as the Mini-Fit Jr. Input Connector. It is provided to use an internal input connector or an external input connector on a custom chassis.


JP40 – Input Aux			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GPI-2	6	GPI-5
2	GPI-1	7	GPI-8
3	GPI-4	8	GPI-7
4	GPI-3	9	OPT-GND
5	GPI-6	10	OPT-GND

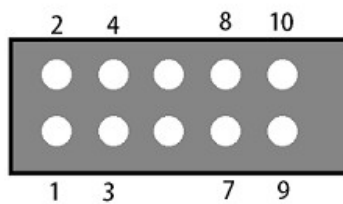

**JP50 – Output Aux**


This contains the same signals as the Mini-Fit Jr. Output Connector. It is provided to use an internal output connector or an external output connector on a custom chassis.

<b>JP50 – Output Aux</b>			
<i><b>Pin No.</b></i>	<i><b>Signal</b></i>	<i><b>Pin No.</b></i>	<i><b>Signal</b></i>
1	GPO-2	6	GPO-5
2	GPO-1	7	GPO-8
3	GPO-4	8	GPO-7
4	GPO-3	9	GND
5	GPO-6	10	VCC

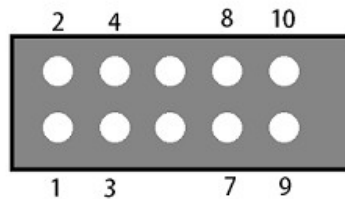**JP53 – Low-Side Relay**

This header contains duplicate signals for Outputs 1&2 in order to drive an internal relay. (Either mounted here or on the power board, depending on configuration.) The clamps provide a reference voltage for use in signal isolation. The output low pins will sink current to drive devices.


<b>JP53 – Low-SideRelay</b>			
<i><b>Pin No.</b></i>	<i><b>Signal</b></i>	<i><b>Pin No.</b></i>	<i><b>Signal</b></i>
1	+5V	4	GPO-1 LOW
2	GPO-2 CLAMP	5	GPO-1 CLAMP
3	GPO-2 LOW	6	GND

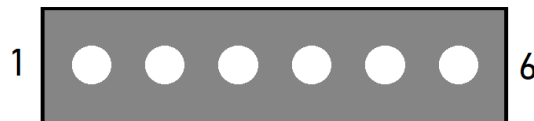

## JP71-75 – Axis Plug-In Interfaces

There are five plug-in interfaces—one for each axis. They are used to add additional functions to the main signal generator board. Most typically, these provide signals to motor drives.

JP71-75 – Axis Plug-In Interfaces						
<i>Pin No.</i>	<i>Function</i>	<i>JP71</i>	<i>JP72</i>	<i>JP73</i>	<i>JP74</i>	<i>JP75</i>
1	HV-PWR	HV-PWR	HV-PWR	HV-PWR	HV-PWR	HV-PWR
2	HV-PWR	HV-PWR	HV-PWR	HV-PWR	HV-PWR	HV-PWR
3	Ground	GND	GND	GND	GND	GND
4	Ground	GND	GND	GND	GND	GND
5	RxD2	RxD2	RxD2	RxD2	RxD2	RxD2
6	Status	STATUS1	STATUS2	STATUS3	STATUS4	STATUS5
7	TxD2	TxD2	TxD2	TxD2	TxD2	TxD2
8	Fault Input	FAULT1	FAULT2	FAULT3	FAULT4	FAULT5
9	Input A	IN8	IN10	IN12	IN14	IN16
10	Direction	DR1	DR2	DR3	DR4	DR5
11	Input B	IN9	IN11	IN13	IN15	IN17
12	Step	ST1	ST2	ST3	ST4	ST5
13	SM0	SM0	SM0	SM0	SM0	SM0
14	SCOM	SCOM1	SCOM2	SCOM3	SCOM4	SCOM5
15	SM1	SM1	SM1	SM1	SM1	SM1
16	CS	CS1	CS2	CS3	CS4	CS5
17	Enable (Global)	ENA	ENA	ENA	ENA	ENA
18	+5V	+5V	+5V	+5V	+5V	+5V
19	Ground	GND	GND	GND	GND	GND
20	Ground	GND	GND	GND	GND	GND

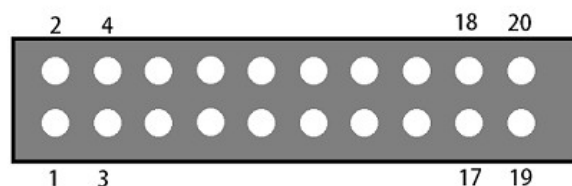

**JP80 – Rear Panel Power**

Connect the main power here. It can be 8.5V – 16V DC.

**JP81 – Rear Panel Fuse**


This is for an optional power fuse. The unit is shipped with a shunt instead of a fuse. If you replace the shunt with a fuse, it should be rated to 1A slow-blow or time-delay.

**JP82 – Front Panel Switch**

If the power supplied to JP80 is not switched, you can connect the main power switch here.

## Servo Power Board

The Servo Power Board supplies logic and motor power, indicates system status and contains circuitry for emergency stop (ESTOP), motor reset and brake functionality.

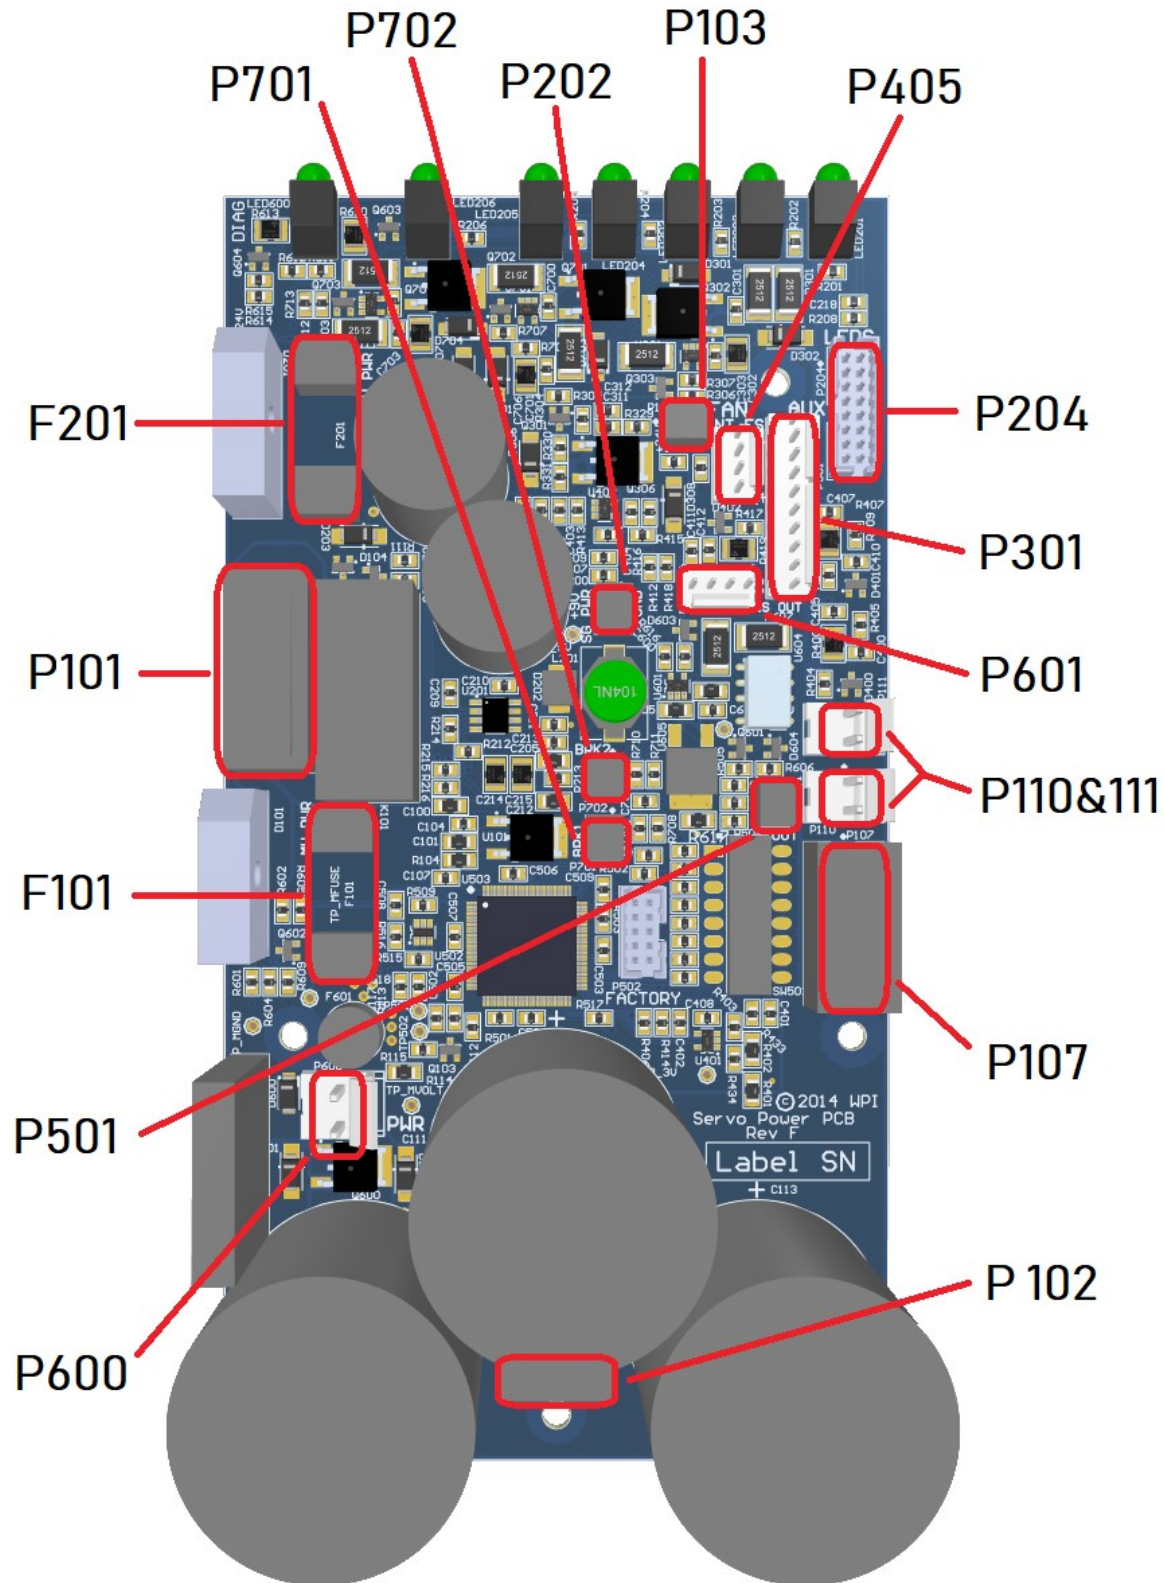


## Internal Connections

### P101 – Transformer Connector

This header is the AC power input for motor and logic power. Pins 4 & 6 are typically wired to unused leads from the transformer but make no connection on the board.


P101 – Transformer Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	24VAC Line	5	MPWR AC Line
2	24VAC Neutral	6	N/C
3	N/C	7	MPWR AC Neutral
4	N/C		

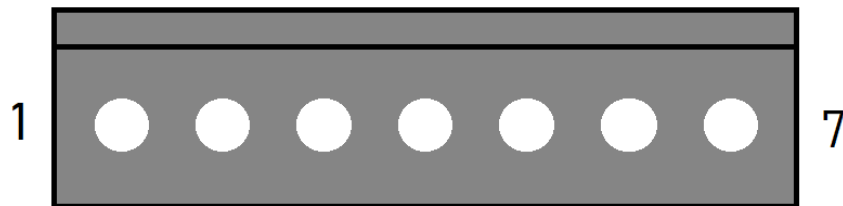

### P102 – AUX Motor Power Connector

This header provides additional access to the DC motor power bus. This bus is shared between P102, P107, P110 and P111.


P102 – AUX Motor Power Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	MPWR DC+	3	MPWR DC-
2	MPWR DC+	4	MPWR DC-

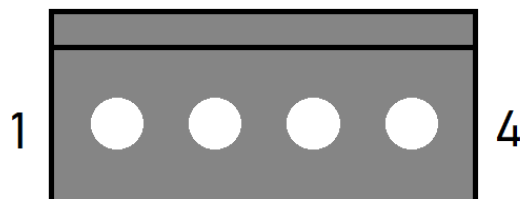

### P103 – Fan Connector

This header is the power source for the system fan.


P103 – Fan Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GND	2	+24VDC

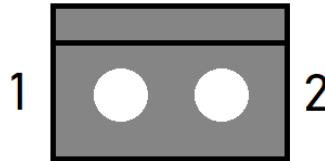

### P107 - Motor Power Connector (x3)

This header provides three pairs of motor power voltage and ground. This bus is shared between P102, P107, P110 and P111.

P107 – Motor Power Connector (3x)			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	MPWR DC-	4	MPWR DC+
2	MPWR DC+	5	MPWR DC-
3	MPWR DC-	6	MPWR DC+

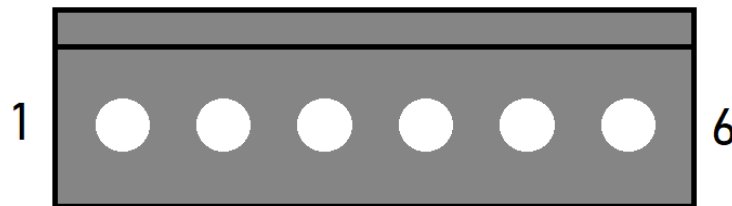




### P110 & P111 – Motor Power Connectors

These headers each provide a pair of motor power voltage and ground. This bus is shared between P102, P107, P110 and P111.


P110 & P111 – Motor Power Connectors			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	MPWR DC-	2	MPWR DC+

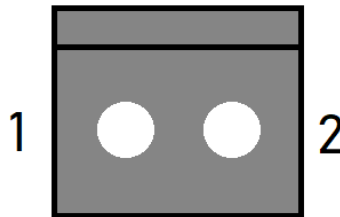

### P202 – Signal Generator Power Connector

This header provides 12V logic power to the Signal Generator.


P202 – Signal Generator Power Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GND	2	+12VDC

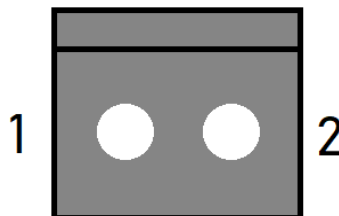

### P204 – LED Connector

This header receives system status information from the Signal Generator.


P204 – LED Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	+5V	9	N/C
2	N/C	10	LED-STEP4
3	N/C	11	N/C
4	LED-STEP1	12	LED-STEP5
5	N/C	13	N/C
6	LED-STEP2	14	LED-USB
7	N/C	15	GND
8	LED-STEP3	16	N/C

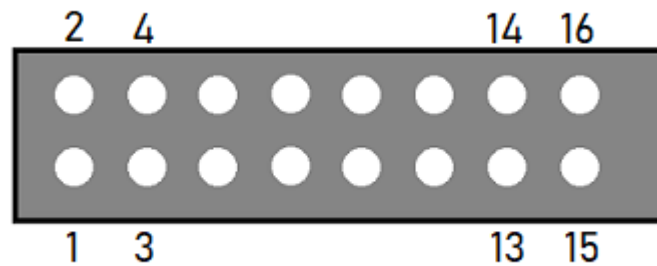

### P301 – Accessory Connector

This header contains the signals of the rear Accessory port. See that section for more details.


P301 – Accessory Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	+24V	6	GND
2	GND	7	ESTOP_EXT+
3	BRAKE1	8	ESTOP_EXT-
4	GND	9	RESET+
5	BRAKE2	10	RESET-

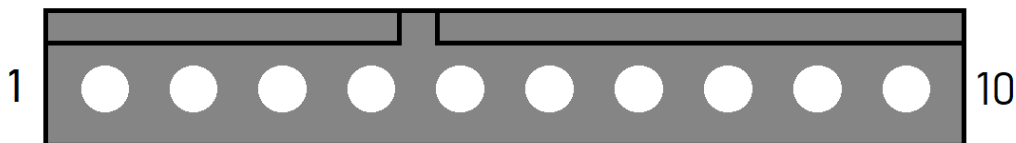

### P405 – Internal Emergency Stop Connector

This header contains internal emergency stop and reset control inputs.


P405 – Internal Emergency Stop Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	ESTOP_INT+	3	RESET_INT+
2	ESTOP_INT-	4	RESET_INT-

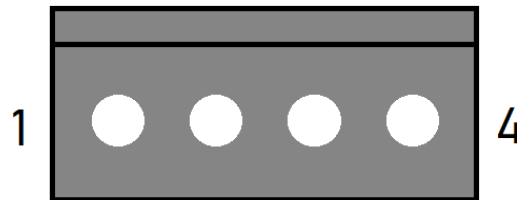

### P501 – Relay Control Connector

This header controls the state of the on-board relay.


P501 – Relay Control Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GND	2	RELAY_IN

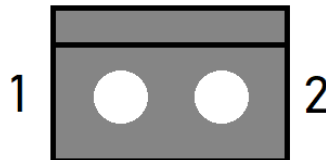

### P600 – Motor Power Resistor Connector

This header connects to the regenerative clamp resistor.


P600 – Motor Power Resistor Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	REGEN_DRIVE	2	MPWR DC+ (Fused)

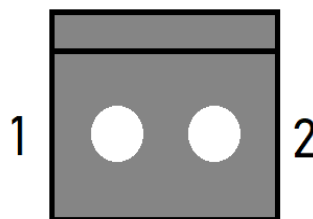

## P601 – Emergency Stop Output Connector

This header outputs emergency stop state and on-board relay contacts.


P601 – Emergency Stop Output Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	RELAY+	3	ES_OUT_LOGIC+
2	RELAY-	4	GND

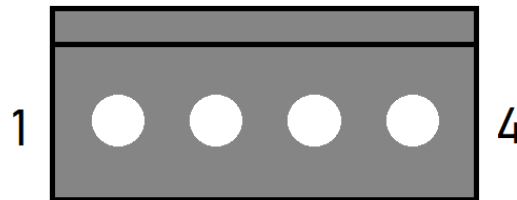

## P701 – Brake 1 Input Connector

This header accepts a signal to activate or disengage brake 1. Typically, this is sourced from a motor drive's output.


P701 – Brake 1 Input Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GND	2	BRAKE1_IN

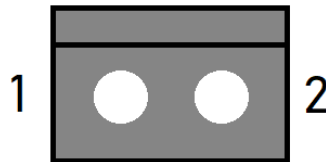

## P702 – Brake 2 Input Connector

This header accepts a signal to activate or disengage brake 2. Typically, this is sourced from a motor drive's output.

P702 – Brake 2 Input Connector			
<i>Pin No.</i>	<i>Signal</i>	<i>Pin No.</i>	<i>Signal</i>
1	GND	2	BRAKE2_IN

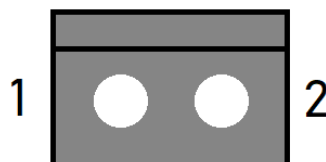

## Switch Settings

### SW502 – DIP Switches

This switch bank controls the settings for various on-board functions.

SW502 – DIP Switches			
SW No.	Function	On State	Off State
1	Reset Configuration	Reset clears ESTOP	No reset function
2	Brake Input Polarity	Active high	Active low
3	Logic Out Config	Logic uses ESTOP	False
4	Relay Out Config	Relay uses ESTOP	False
5	Internal ESTOP	Used	Not used
6	External ESTOP	Used	Not used
7	Under V Monitor	Used	Not used
8	N/A	N/A	N/A

**Reset Configuration:** When enabled, pins 3&4 on P405 must be jumped momentarily to activate motor power when all ESTOPs are cleared.

**Brake Input Polarity:** This setting determines whether a high or low signal across P701 and P702 will cause the respective brake outputs on P301 to be active.

**Logic Out Config:** When enabled, pin 3 on P601 will reflect the state of motor power.

**Relay Out Config:** When enabled, the relay output on pins 1&2 on P601 will be open if an ESTOP event is active.

**Internal ESTOP:** When enabled, pins 1&2 on P405 must be jumped to clear an ESTOP event.

**External ESTOP:** When enabled, pins 7&8 on P301 must be jumped to clear an ESTOP event.

**Under V Monitor:** When enabled, the power board will report under-voltage states.

## ***Fuses***

### **F101 – Motor AC Fuse**







This fuse protects the drive power supply circuitry. It should be replaced with a 250 VAC, 8-16A Time Lag (Slow Blow) 5x20mm.

### **F201 – 18.8VAC Fuse**

This fuse protects the circuitry that provides power to the logic of the Signal Generator and its subsystems. It should be replaced with a 250 VAC, 4A Time Lag (Slow Blow) 5x20mm fuse.

## ***LED Indicators***

The Power / Status LED provides visual indication of power board status and operation through blink codes and color codes, shown below:

Code	Error
 solid green	no error
 flashing green	ESTOP closed, waiting for RESET
 solid red	low motor power
 2 green, 2 red	low 24V
 1 green, 3 red	regen resistor locked
 alternating	ESTOP open

## Controller Maintenance

### *External Maintenance*

#### **Fan Filter**

The intake fan filter should be cleaned periodically. The time between cleanings is dependent on the controller's environment and should be performed whenever debris buildup is noticeable. First, remove the filter cover by pulling directly away from the controller. You may need to use a small flathead screwdriver or similar tool to pry one or more of the corners away from the fan mount, as shown below.



Next, remove the foam filter and use a vacuum or compressed air to remove debris. Do not use water or cleaning products to clean the filter. Once cleaned, replace the filter in the filter cover and reattach it to the controller.

#### **Power Inlet Fuses**

The power inlet contains two 20x5mm fuses rated at 10A 250V. To replace the fuses, remove the fuse tray. See the next page for detailed instructions.

To access the fuses:

1. Remove the power plug from the inlet, then release one of the side tabs.



2. Release the other side tab.



3. Use the center tab to remove the fuse tray.






## Internal Maintenance

### Removing The Lid

Before installing or replacing internal components, unplug the power cable and remove the lid. The lid is secured by eight 6-32 screws on the sides of the chassis. Remove these using a P2 Phillips screwdriver and lift the lid off of the controls.

### Replacing Fuses

If your system demands more power than can be safely output, you might blow a fuse on the system's power board. Fortunately, these fuses are replaceable. See the following picture for their location. They are both 20x5mm form factor. F101 is—by default—rated to 10A but is compatible with up to a 16A fuse if your demands exceed the default. F201 is rated at 4A.

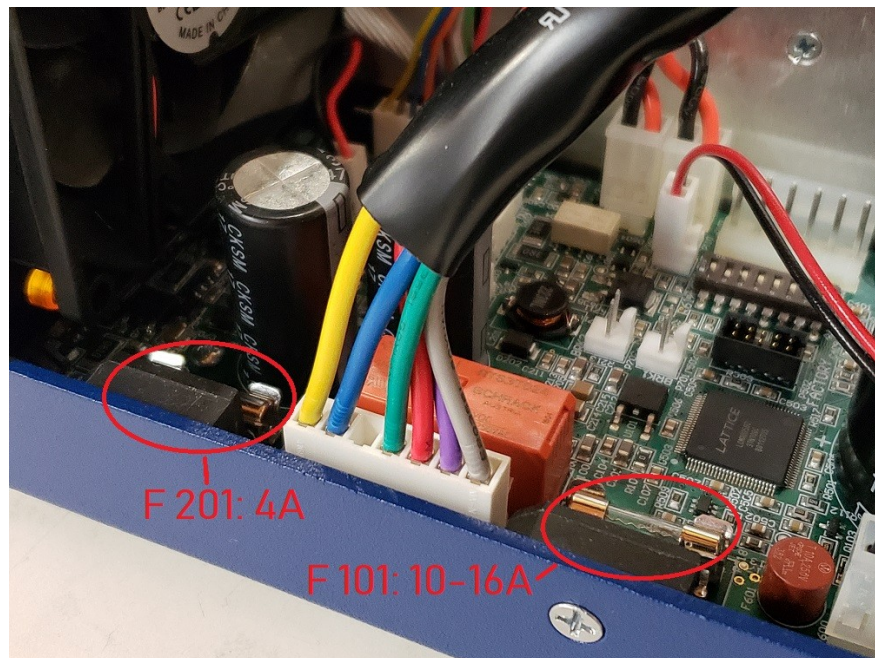


## Adding/Replacing a Drive

To upgrade your CNC controller—such as adding a 4th or 5th axis—you should install the new drive module(s) using the following instructions.

Improper wiring can cause damage to your controller or motors. Please take care in following these instructions properly. Please refer to the pictures below for the correct connectors.


1. Set the dip switches and configure the new drive to the appropriate settings for your application. See the Motor Drive Settings section of this manual for more information.
2. If replacing a drive, remove the two mounting screws and unplug all connectors.

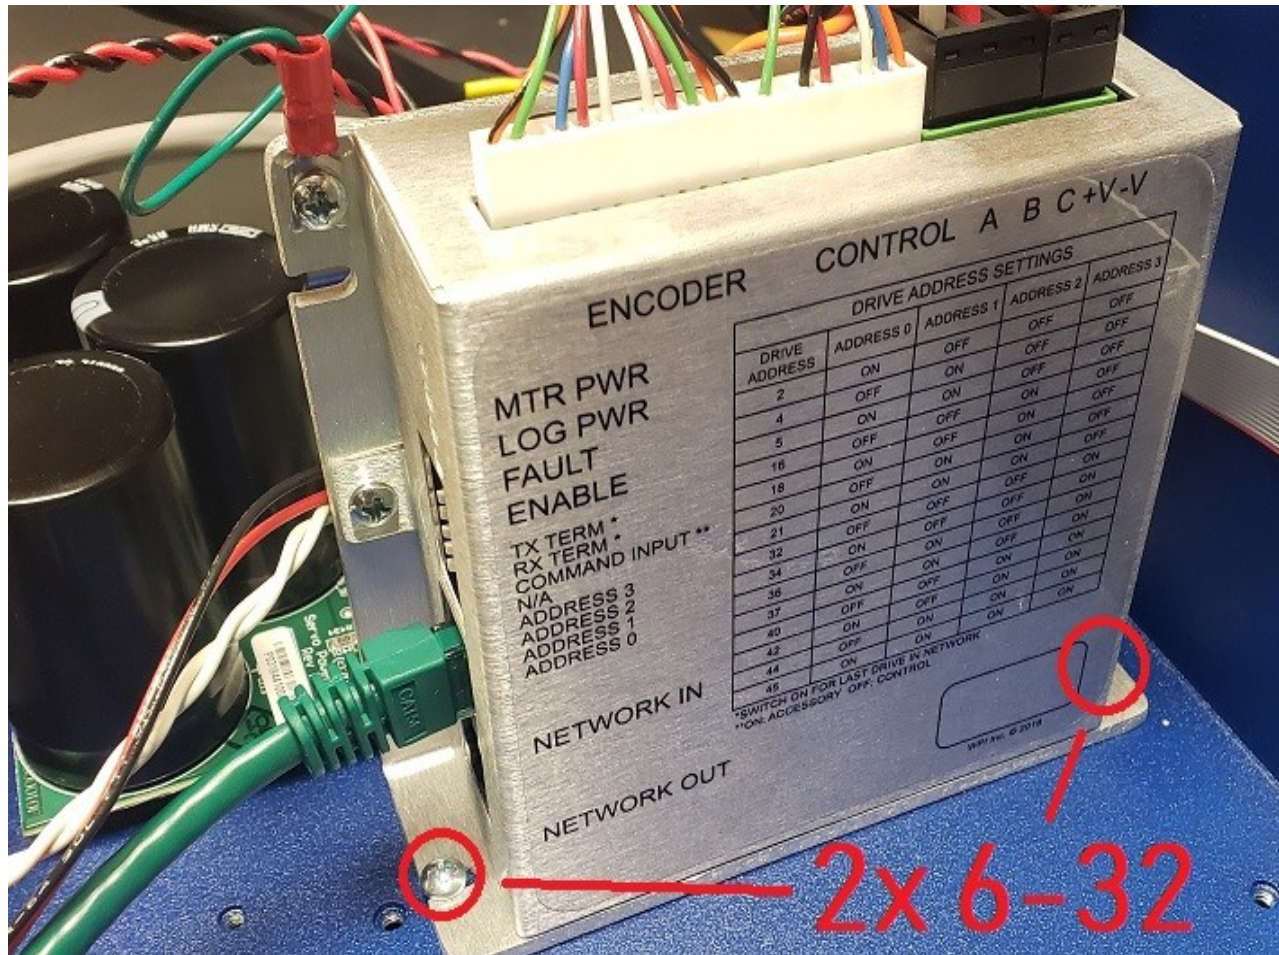

3. Add or replace the drive and mount to the bottom of the chassis using two 6-32 screws. Do not use plastic hardware.



4. Connect the input motor power cable from the power board to V+ & V- on the drive.
5. Connect the output motor power cable from the rear of the chassis to the drive's A, B & C output.
6. Connect the encoder feedback cable to the drive's Encoder signals.
7. Connect the Control signals of the drive to an axis interface connector on the Signal Generator with a step/direction cable. Make sure to attach the ground wire to the drive's chassis.
8. Connect the drive to the network using communication patch cables.

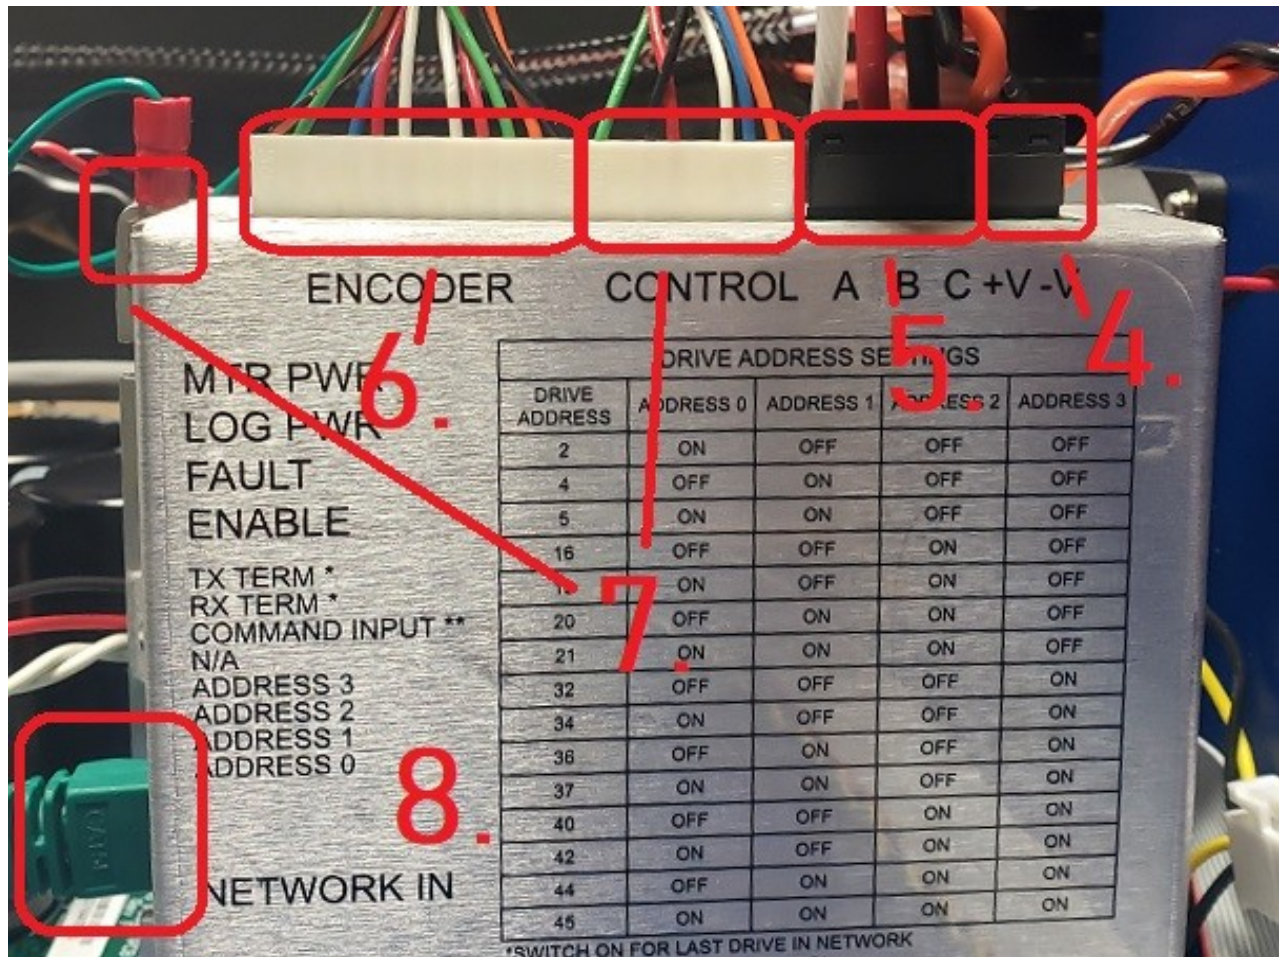

### *Signal Locations*

The following table contains every instance of each signal in the system. Note that not all systems are equipped with the Mini or Classic I/O Expansion boards but these can be installed in-field. Also please note that Compact Series controllers do not support the Classic I/O Expansion board.

[illegible]

<b>Signal Locations</b>																		
	<b>Signal Generator</b>									<b>Mini I/O</b>	<b>Classic I/O</b>							
<b>Signal</b>	<b>CON5</b>	<b>CON4</b>	<b>CON3</b>	<b>JP30</b>	<b>JP40</b>	<b>JP50</b>	<b>JP53</b>	<b>JP33</b>	<b>JP71-75</b>	<b>P103</b>	<b>CON4</b>	<b>CON5</b>	<b>CON6</b>	<b>JP40</b>	<b>JP50</b>	<b>JP20</b>	<b>JP21</b>	<b>JP22</b>
Input 31				5													3	
Input 32				3													1	
Output 1	1		1			2	4			6&15								47
Output 2	6		2			1	3			7&16								45
Output 3	2					4												43
Output 4	7					3												41
Output 5	3					6												39
Output 6	8					5												37
Output 7	4					8												35
Output 8	9					7												33
Output 9												1	2		2	17		
Output 10												6	4		1	19		
Output 11												2			4	21		
Output 12												7			3	23		
Output 13												3			6	25		
Output 14												8			5	27		
Output 15												4			8	29		
Output 16												9			7	31		
Output 17																		31
Output 18																		29
Output 19																		27
Output 20																		25
Output 21																		23
Output 22																		21
Output 23																		19
Output 24																		17
Output 25																		15
Output 26																		13
Output 27																		11
Output 28																		9
Output 29																		7
Output 30																		5
Output 31																		3
Output 32																		1
Analog Input 1										18								
Analog Output 1										17			6					
Analog Output 2													8					
PWM Output										14								



## ***Voltage/GND Locations***

The following sections list the locations of different voltages and ground.

### **+5VDC**

- Signal Generator
  - CON5.5
  - CON3.22
  - JP50.9
  - JP53.6
  - JP33.11
  - JP71-75.20
- Mini I/O
  - P103.13

### **GND**

- Signal Generator
  - CON5.10
  - CON3.24
  - JP30.19, 20, 39, 40
  - JP50.9
  - JP53.6
  - JP33.11
  - JP71-75.20
- Mini I/O
  - P103.4, 5, 8, 9
- Classic I/O
  - CON5.10
  - CON6.3, 7
  - JP20.2, 3, 4, 6, 8, 9, 10, 12, 14, 15, 16, 18, 20, 22, 24, 26, 28, 30
  - JP22.2, 4, 6, 8, 10, 12, 14, 16, 18, 20, 22, 24, 26, 28, 30, 32, 34, 36, 38, 40, 42, 44, 46, 48, 50

**OPT-VCC**

- Signal Generator
  - CON3.23

**OPT-GND**

- Signal Generator
  - CON4.1, 2, 3, 4, 5, 6, 7, 8
  - CON3.25
  - JP40.9, 10
- Classic I/O
  - JP40.2, 4, 6, 8, 10, 12, 14, 16
  - JP50.9
  - JP20.34, 36, 38, 40, 42, 44, 46, 48, 50
  - JP21.2, 4, 6, 8, 10, 12, 14, 16, 18, 20, 22, 24, 26, 28, 30, 32, 34, 36, 38, 40, 42, 44, 46, 48, 50

**+12VDC**

- Classic I/O
  - CON6.1




# Wiring Appendix

## Example Wiring

### Typical Output Line Circuit


The schematic below shows a typical connection of one solid state relay controlled by output line 1 of the Signal Generator. A typical load could be a spindle, a vacuum, a laser, etc. In this example, the solid-state relay used is a Continental Industries model S505-0SJ610-000.

Each of the output signals has a 22-ohm resistor in series with their outputs. This is to reduce any “ringing” at the transient switching points. Ground and 5V are provided on this connector for your convenience. The FlashCut Spindle On/Off Relay Box is wired as shown in the below schematic.

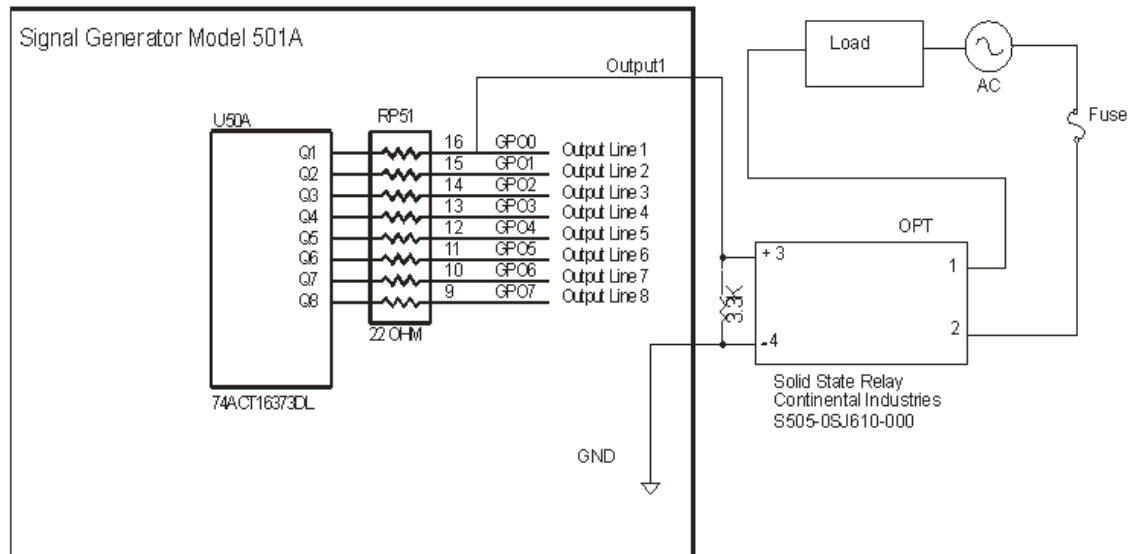


## Typical Input Line Circuit – Internal Power

The following schematics show a typical connection of five normally closed switches. These switches are connected between input lines 1-5 and ground. Lines 6-8 are connected directly to ground with jumper wires. All external connections shown are made through the Input connector on the back of the Signal Generator. This resistor pack (RP 41) is socketed so that you can change the value if needed for your application.

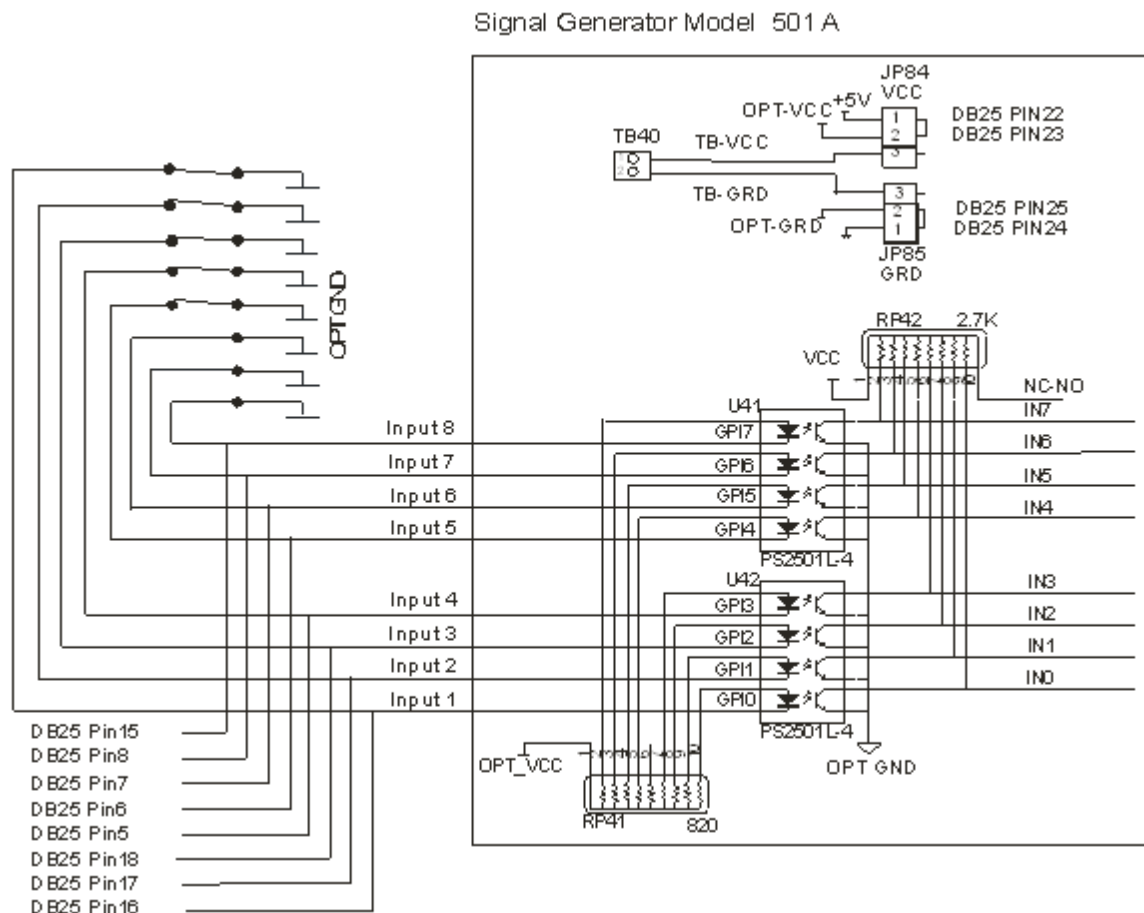

## Typical Input Line Circuit – External Power

The input lines are all optically isolated. In this example, JP84 and JP85 are shorted using the internal power to source the external side of the optical couplers. However, for the best isolation, JP84 and JP85 should be open, and power should be provided through pins 23 and 25 of the DB25 Motor Signal connector. Input lines 1-4 and 5- 8 are internally connected to pins 15- 18 and 5-8 respectively of the DB25 Motor Signal connector.

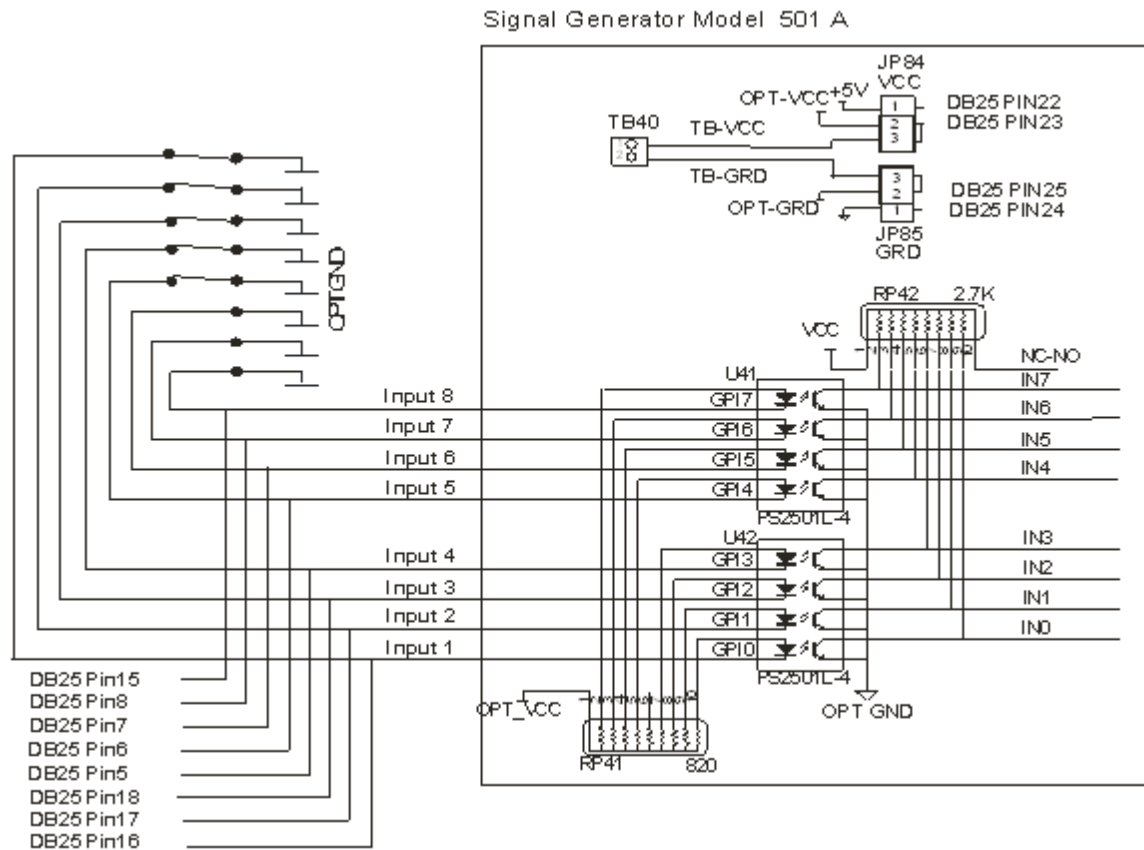


Note that the FlashCut CNC limit switch kit has the same wiring as shown in this example.

## Proximity Sensors

When connecting a proximity type sensor, connect to the controller using the following diagram.


Please note only NPN type proximity sensors are compatible with the controller. Most sensors require the use of a higher, external voltage supply than the standard 5V to operate. Please see the information on Inputs in the Signal Generator section for more information on wiring OPT VCC.

### NPN Proximity Sensor

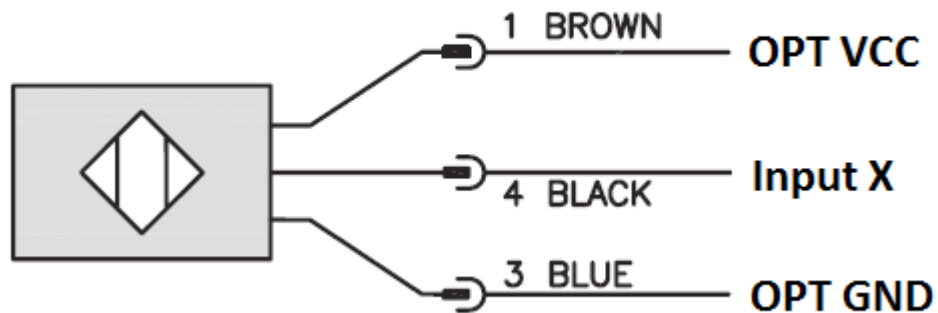





Fuse Reference	Fuse Location	Amperage (A)	Voltage	Size (mm)
F10-125	Power Inlet	10	125 VAC	5 X 20
		5	250 VAC	5 X 20
F04-17	Power Board Logic Supply	4	17 VAC	5 X 20
F10-5/	Power Board Drive Supply	10	5/ VAC	5 X 20
F03-24	24 VDC Supply Out	3	24 VDC	5 X 20

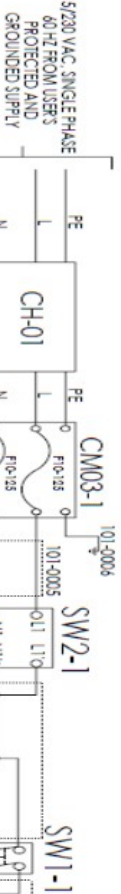

Optional Configurations:

1. None
2. Relay
3. 24V

Optional Configuration  
1. 500W Transformer  
2. 1000W Transformer

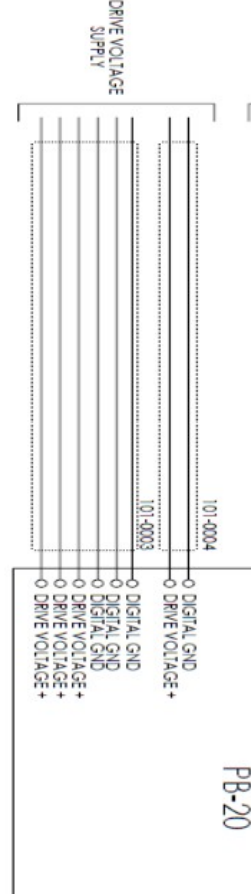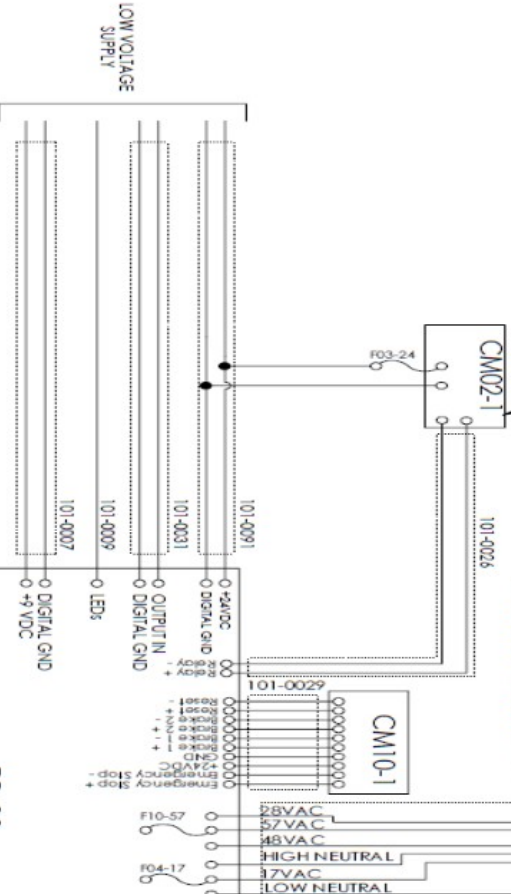

REFERENCE DESIGNATOR	DESCRIPTION
CM03-1	2 Circuit Male Plugable Terminal Block IEC 320 Rated Power Inlet
CM10-1	10 Circuit Male Plugable Terminal Block
DC-F10	24VDC Fan
ETH-06	6 Ethernet Cable
ETH-12	12 Ethernet Cable
MD-10	Aux 1 Motor Drive
MD-11	Aux 2 Motor Drive
MD-12	Aux 3 Motor Drive
MD-13	Aux 4 Motor Drive
MPC-10	Aux 1 Motor Power Connector
MPC-11	Aux 2 Motor Power Connector
MPC-12	Aux 3 Motor Power Connector
MPC-13	Aux 4 Motor Power Connector
MCC-4	Motor Connector Cover
OC-01	Classic I/O Expansion Daughter Board
OC-03	Mini I/O Expansion Daughter Board
PB-10	Power Board
PC-11	End User Supplied PC
SG-10	Signal Generator Board
SW-11	Voltage Selector Switch
SW-21	Monitored On-Off Toggle Switch
XTR-1	Isotropical Transformer
LED-1	Green LED Aux 1 Motion Indicator
LED-2	Green LED Aux 2 Motion Indicator
LED-3	Green LED Aux 3 Motion Indicator
LED-4	Green LED Aux 4 Motion Indicator
LED-5	Green LED Aux 5 Motion Indicator
LED-6	Green LED Controller Power Indicator
LED-1	Amber LED USB Connection Indicator
FI0-25	5000mm Fuse 10A 250VAC
FI0-24	5000mm Fuse 3A 250VAC
FI0-17	5000mm Fuse 14A 250VAC
FI0-87	5000mm Fuse 10A 250VAC
CH-01	6 18AWG NEMA 5-15 to IEC 320 C13 Power Cord
RLY-01	Relay Daughter Board
RS-45-202	RS 485 to RS 232 Adapter
101-0003	3 Aux Drive Power Cable
101-0004	Single Aux Drive Power Cable
101-0005	Mains Power In to Switch
101-0006	Protective Earth Cable
101-0007	Signal Generator Power Cable
101-0009	LED Cable
101-0013	Servo Motor Feedback Cable
101-0014	Servo Motor Power Cable
101-0020	Signal Generator to Drive Signal Cable
101-0023	Transformer Harness
101-0026	Servo Relay Cable
101-0028	Fan Harness
101-0029	Accessory Harness
101-0031	Relay Control Cable
101-0091	24 VDC Power Supply Cable

